

U.S. Department of Transportation


National Highway Traffic Safety Administration

Dear Crash Data Researchers/Users:

Thank you for choosing crash data from the National Highway Traffic Safety Administration (NHTSA) for your research or other use. The information contained in this motor vehicle crash report is collected, maintained and distributed in accordance with Public Law 89-564. In accordance with this Public Law, NHTSA is required not to release any case information until completion of quality control procedures. These procedures include a review of the case material to extract all names, licenses and registration numbers, non-coded interview material, non-research related researcher comments in the margins, non-factual data, and the production number portion of the vehicle identification number (VIN).

If you requested NHTSA to query its database files in order to identify a specific crash, then that query was made using non-personal descriptors you provided for use in our search. This motor vehicle crash may have been identified from a data search and matches the general, non-personal descriptors you provided, but we cannot confirm that this is the specific crash report you requested.

If you have any questions with regard to the above procedures, please contact the Field Operations Branch, Crash Investigation Division, National Center for Statistics and Analysis at 202-366-4820. Again, please be advised that we cannot confirm that this is the case that you have specifically requested nor can we certify the information to be correct.

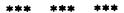



Case Vehicle (A): 1999 Saturn

Type: SL2, 4-door sedan Driver: 46-year-old female CDC: 01-FDEW-1, 03-RBLE-1

SITUATION

(Slides 1, 2) On a rainy night, case vehicle (A) was traveling east at a driver-estimated speed of 65 mph (106 kph) in the left lane of a limited-access freeway. The freeway is a 6-lane asphalt road, divided by a concrete barrier between the east and west lanes of travel. The roadway was wet and that portion of the freeway was dark and unlighted. The driver of case vehicle (A) reportedly braked due to slow traffic ahead, and lost control of the vehicle. The vehicle exited the north shoulder in a counterclockwise yaw and struck the concrete median wall with its right bumper corner. After the frontal impact, case vehicle (A) struck the wall again with its right rear corner, where it came to rest against the wall facing west. Case vehicle (A) was towed due to damage and the driver was transported to a local hospital with police reported "C" injuries.

GENERAL VEHICLE DAMAGE AND ESTIMATED CRASH SEVERITIES

(Slide 3) The first impact to the front of case vehicle (A) was minor. The direct damage began at the right-front bumper corner and extended 100 cm across the front bumper, resulting in 72-percent vehicle overlap. The maximum crush was 19 cm to the right-front bumper corner. The second impact to the right-rear bumper corner was very minor and resulted in scratches that extended 29 cm along the right side of the bumper cover.

Using the WinSMASH accident-reconstruction program and c-values measured for (slides 4, 5, 6, 7, 8 and 9) case vehicle (A), the following impact severity was calculated for the frontal impact with the median wall.

| | | Calculated Velocity Change - kph (mp | | | |
|------------------|----------|--------------------------------------|--------------|-------------|--|
| Vehicle | Variable | Total | Longitudinal | Latitudinal | |
| Case Vehicle (A) | delta V | 21 (13) | -15 (-9) | -15 (-9) | |

DESCRIPTION OF DAMAGE TO CASE VEHICLE (A)

Exterior

(Slides 10, 11 and 12) Damage to the front of case vehicle (A) included the bumper, the grille area, and the right headlight assembly. (Slides 13, 14 and 15) The hood was crushed and slightly elevated in the rear, but it did not contact the undamaged windshield. There was no damage to the hood latch or hood hinges.

(Slide 16) On the right side, the front fender was damaged and shifted to the left. (Slide 17) There was no damage to the right-side exterior door panels, and both doors were operational. (Slide 18) Also, there was no damage to the right A-, B-, or C-pillars, or to the right wheels, and there was no change in the right wheelbase. (Slide 19) On the left side, the front fender was deformed and shifted slightly to the left. There was no damage to the left-side door panels, and both left doors were operational. (Slide 20) Also, there was no damage to the A-, B-, or C-pillars, and no change in the left wheelbase.

(Slides 21, 22) There were scratches on the right corner of the rear bumper from contact with the median wall during the second impact. There was no other damage to the rear of case vehicle (A).

Interior

(Slides 23, 24) This vehicle is equipped with steering-wheel and passenger frontal-impact airbags, which deployed during the first impact. (Slide 25) There was no visible evidence of contact on the steering-wheel airbag skin. (Slides 26, 27) There was no damage to the steering-wheel rim and no rotation of the steering column. (Slides 28, 29 and 30) There was no damage to the upper or mid portion of the instrument panel, center dash area, or glove compartment. (Slides 31, 32) There was a scuff mark on the left portion of the knee bolster indicating driver contact, but there was no damage to the panel. (Slides 33, 34 and 35) In addition, there was no damage to the roof, windshield, or A-pillars. (Slide 36) There was a cut in the plastic roof siderail, due to contact by the driver's hand and ring. There was no other interior damage and no intrusions were noted.

OCCUPANT KINEMATICS AND INJURIES

(Slide 37) The 5-ft, 6-in, 130-lb, 46-year-old female driver was wearing the available three-point belt, and the airbag deployed during the frontal impact. (Slides 38, 39) Webbing imprints on the D-ring from the shoulder-belt webbing indicate belt use at the time of the crash. (Slide 40) The shoulder-belt anchor point was adjusted to the highest position on the B-pillar, and the driver reportedly had the seat in a mid seat-track position. She reportedly had her hands at the 10 and 2 o'clock positions on the steering-wheel rim.

During the frontal impact with the median wall, the driver moved forward and to the right relative to the vehicle interior, and into the belt restraint and airbag. (Slide 41) She sustained a contusion to her right hip, probably due to loading by the seatbelt buckle assembly, or possibly from contact with the center console/armrest. (Slide 42) The deploying airbag propelled her left hand upward into the left roof siderail, and her wedding ring gouged the plastic cover. This contact resulted in a contusion to her left ring finger and contusions across her left knuckles. (Slides 43, 44) In addition, she sustained a contusion to her left knee, probably due to contact with the knee bolster, as indicated by scuff marks to the panel.

The following table and attached drawing (slide 45) summarize the injuries for the restrained driver.

Occupant: Driver Restraints: 3-point belt worn; airbag deployed

Age: 46 years Stature: 168 cm (5 ft, 6 in)

Gender: Female

Mass: 59 kg (130 lb)

| | | | Injury Source | | |
|-----------------------------|----------|----------|------------------------------|------------------------|--|
| Injury Description | A.I.S. | Definite | Probable | Possible | |
| Contusion, left ring finger | 1 | | Roof siderail (airbag fling) | | |
| Contusions, left knuckles | 1 | | Roof siderail (airbag fling) | | |
| 4-cm contusion, right hip | 1 | | Seatbelt buckle assembly | Center console/armrest | |
| Contusion, left knee | 1 | | Knee bolster | | |
| | | | | | |
| Maximum A.I.S. Level | 1 | | ! | t . | |
| Injury Severity Score | <u>1</u> | | | | |

| Duplicate columns 1-8 Module <u>G</u> <u>I</u> Format <u>(</u> from the previous card. 9 10 1 | 0 2 | GENERAL INFORMATION | GI-1 |
|---|-------|--|-------------------|
| TIME DATE OF COLLISION | _ | ENVIRONMENTAL CONDITIONS CONSTRUCTION ZONE (0) NO (1) YES (9) UNKNOWN ROAD ALIGNMENT VERTICAL PLANE (1) LEVEL (2) CREST OF HILL (3) SLOPE (2%) (4) BOTTOM OF HILL (9) UNKNOWN | <u>O</u> 33 |
| STATE FIPS CODE AREA (1) URBAN (2) RURAL (9) UNKNOWN | 25 26 | ROAD ALIGNMENT HORIZONTAL PLANE (1) STRAIGHT (2) CURVE (3) T - SHAPED (4) Y - SHAPED (7) OTHER: (9) UNKNOWN | 35 |
| ENVIRONMENTAL CONDITIONS LIMITED-ACCESS HIGHWAY (0) NO (1) YES (9) UNKNOWN ROAD, TOTAL TRAFFIC LANES | 28 | SURFACE COVERING (10) DRY (21) WATER - DAMP (22) WATER - WET (23) WATER - PUDDLED (29) WATER - AMOUNT UNKNOWN | <u>2</u> <u>3</u> |
| (FOR CASE VEHICLE) (1) 1-LANE (2) 2-LANES (3) 3-LANES (4) 4 OR MORE LANES (5) DIVIDED, 4 OR MORE LANES (6) PARKING LOT/DRIVEWAY (7) OTHER: (9) UNKNOWN | 5 | (31) SNOW - LOOSE (32) SNOW - PACKED (39) SNOW - CONDITION UNKNOWN (41) ICE (51) SLUSH (61) SPILLED GRAVEL (71) OTHER: (99) UNKNOWN VISIBILITY LIMITATION | |
| INTERSECTING RD, TOTAL LANES CHOOSE FROM ABOVE LIST, OR (8) NOT APPLICABLE TYPE OF ROAD SURFACE (1) ASPHALT | 8 | (FOR CASE VEHICLE) (0) NONE (1) CLOUDY/DARK (2) FOG (3) SMOKE (4) WINDSHIELD CONDITION (5) GLARE (6) RAIN (7) OTHER: | 38 |
| (2) CONCRETE (3) GRAVEL (4) MORE THAN ONE (CIRCLE EACH) (7) OTHER: (9) UNKNOWN ROAD DEFECTS (0) NO (1) YES (9) UNKNOWN | 31 | (8) ICE/SNOW (9) UNKNOWN VISIBILITY OBSTRUCTION (FOR CASE VEHICLE) (0) NONE (1) BUILDING (2) SIGN (3) VEGETATION (E.G. BUSHES, SHRUBS) (4) TREE (5) HILL OR CURVE IN ROAD (6) VEHICLE IN TRANSPORT (7) OTHER: (8) PARKED VEHICLE (9) UNKNOWN | 39 |
| | | (9) CHAICHACAAIA | |

| GENERAL INFORMATION GI-2 | | | | |
|--|-----------|---|--|--|
| ENVIRONMENTAL CONDITIONS SPEED LIMIT (0) 5-45 km/h 5-25 mph (1) 46-55 30 (2) 56-60 35 (3) 61-70 40 (4) 71-79 45 (5) 80-85 50 (6) 86-90 55 (7) 91-105 60 (8) OVER 105 65 (9) UNKNOWN | <u>\$</u> | MECHANICAL MALFUNCTION WAS THERE MENTION OF A MECHANICAL MALFUNCTION IN CASE VEHICLE (0) NO (1) YES (2) YES, DID NOT CONTRIBUTE TO ACCIDENT (#) UNKNOWN | | |
| PRECIPITATION | 41 9 43 | THE FOLLOWING SECTION SHOULD BE FILLED OUT IF A MECHANICAL MALFUNCTION IS RECOGNIZED OR SUSPECTED. CIRCLE ITEMS INVOLVED. SUPPORT ANY ITEMS CIRCLED WITH COMMENTS. BRAKE SYSTEM DRIVER CONTROLS EXHAUST SYSTEM POWER TRAIN STEERING SYSTEM FUEL SYSTEM SUSPENSION SYSTEM VISIBILITY ITEMS ELECTRICAL SYSTEM TIRES THROTTLE CONTROLS UNKNOWN OTHER: COMMENTS: | | |
| CROSSWIND (0) NONE (1) LIGHT (2) STRONG (3) GUSTY & STRONG (9) UNKNOWN LIGHT CONDITIONS (1) DAYLIGHT (2) DAWN (3) DUSK (4) DARK, LIGHTED (5) DARK, UNLIGHTED (6) DARK, UNKNOWN IF LIGHTED (9) UNKNOWN | 944 | | | |

| | | GENERAL INFORMATION | GI-3 |
|--|-------------|---|---------------|
| CRASH DETAILS CASE VEHICLE AND OBJECT (0) NO (1) YES (9) UNKNOWN CASE VEHICLE ROLLOVER | 47 | HIGHEST POLICE INJURY SEVERITY CODE IN CRASH (NOT JUST CASE VEHICLE) (0) O - NO INJURY (1) C - POSSIBLE INJURY (2) B - NON-INCAPACITATING INJURY (3) A - INCAPACITATING INJURY (4) K - FATAL (5) INJURED, SEVERITY UNKNOWN (6) DIED PRIOR TO ACCIDENT | |
| (0) NO ROLLOVER (1) YES, FIRST EVENT (2) YES, SUBSEQUENT EVENT (3) YES, SEQUENCE UNKNOWN (9) UNKNOWN | 48 | (7) NON-FATAL INJURY SEVERITY UNKNOWN (9) UNKNOWN DRIVER IMPAIRMENT | 55 |
| CASE VEHICLE RAN OFF ROADWAY (BEFORE FIRST IMPACT) (0) NO (1) YES (9) UNKNOWN | 49 | DRIVER ALCOHOL INVOLVEMENT (CASE VEHICLE) (0) NONE (1) YES (9) UNKNOWN/NOT REPORTED/ NO DRIVER | <u>O</u> 56 |
| MOVING CASE VEHICLE AND CONTACTED MOVING VEHICLE (0) NO (1) YES (9) UNKNOWN | <u>Ø</u> | DRIVER ALCOHOL BAC (CASE VEHICLE) (80) NO TEST (90) CHEMICAL TESTS, NO RESULTS (95) AUTOPSY, NO RESULTS (99) UNKNOWN | . 80 |
| CASE VEHICLE AND CONTACTED STOPPED VEHICLE (0) NO (1) YES (9) UNKNOWN | <u>Ø</u> | WAS THERE MENTION OF DRIVER IMPAIRMENT FOR CASE VEHICLE? (0) NO (1) YES (9) UNKNOWN | 59 |
| STOPPED CASE VEHICLE AND CONTACTED VEHICLE (0) NO (1) YES (9) UNKNOWN | <u>0</u> | LIST IMPAIRMENTS MENTION | IED: |
| TOTAL NUMBER OF VEHICLES CONTACTED BY CASE VEHICLE IN CRASH (8) 8 OR MORE (9) UNKNOWN | <u>Ø</u> | Post - Crash Detail MANNER CASE VEHICLE LEFT SCENE | |
| ANY FIRE IN THIS CRASH (NOT JUST CASE VEHICLE) (0) NO (1) YES (9) UNKNOWN | <u>O</u> 54 | (1) DRIVEN (2) TOWED DUE TO DAMAGE (3) TOWED, NOT DUE TO DAMAGE (4) TOWED, REASON UNKNOWN (9) UNKNOWN | <u>2</u> |

ACCIDENT SCHEMATIC

| ACCIDENT DESCRIPTION: CASE VEHICLE (A) WAS TRAVELING CASE VEHICLE (A | |
|--|---|
| EAST AT A DRIVER-ESTIMATED SPEED OF 65 MPH OTHER VEHICLE (I | |
| (106 KPH) IN THE LEFT EASTROUND CANE OF A THIRD VEHICLE (| |
| LIMITED - ACCESS HIGHWAY. EMSTBOUND TRAFFIC WAS SLOW AND | |
| THE DRIVER OF CASE VEHICLE (A) BRAKED AND LOST CONTROL | \ |
| VEHICLE. IT EXITED THE NORTH SHOULDER AND STRUCK THE CO | |
| MEDIAN. AFTER THE IMPACT IT RETATED AND STRUCK THE WALL WITH | 17 RIGHT REM. NORTH |
| | |
| shoulder | |
| silouide | |
| | |
| westbound travel | |
| | |
| Concrete Median | |
| | 1 |
| | Maria Maria |
| A4 | shoulder |
| $\begin{array}{c} A1 \\ \hline \end{array}$ | |
| eastbound travel | |
| castbound travel counter- | |
| | |
| | |
| | shoulder |

| Duplicate columns 1-8 Module O V Format 0 4 from the previous card. | OTHER VEHICLE (| OV-1 |
|--|--|----------|
| MAKE: | | |
| VIN | | |
| MANUFAC/BODY CODE | VEHICLE TYPE | |
| MAKE/MODEL CODE | PASSENGER VEHICLE (02) LARGE (03) LIMOUSINE (17) PICKUP CAR (20) UNKNOWN PASSENGER VEHICLE BODY | 56 57 |
| MODEL YEAR | (24) SUB-MINI (25) MINI (26) SUB-COMPACT (27) COMPACT | |
| VEHICLE MASS (kg) | (28) INTERMEDIATE (29) FULL | |
| IF SEPARATE REPORT WAS MADE, GIVE VEHICLE NUMBER | E.G. PANEL TROCK, SUBURBANI | |
| NUMBER OF OCCUPANTS (ENTER 9'S IF UNKNOWN) 51 | (16) PICKUP TRUCK WITH CANOPY/SHELL COVER (17) PICKUP CAR WITH CANOPY/SHELL COVER (21) MOTOR HOME (22) PICKUP TRUCK WITH SLIDE-IN CAMPER (23) PICKUP CAR WITH SLIDE-IN CAMPER (31) CHASSIS-MOUNTED CAMPER | |
| TRAVELING SPEED (km/h) (000) PARKED OR STOPPED (995) JUST STARTING UP (996) BACKING UP (997) SPEED NOT EXCESSIVE (BUT UNKNOWN) (998) SPEED EXCESSIVE (BUT UNKNOWN) (999) UNKNOWN | TRUCK (11) VAN (12) PICKUP TRUCK (13) UNKNOWN LIGHT TRUCK (15) LARGE UTILITY (E.G. PANEL TRUCK, SUBURBAN) (16) PICKUP TRUCK WITH CANOPY/SHELL COVER (22) PICKUP TRUCK WITH SLIDE-IN CAMPER (30) UNKNOWN TRUCK TYPE (31) CHASSIS-MOUNTED CAMPER (33) DELIVERY VAN (WALK-IN) | |
| HIGHEST POLICE INJURY SEVERITY CODE FOR THIS VEHICLE | (34) STRAIGHT TRUCK (35) TRUCK-TRACTOR (BOBTAIL) (36) CHASSIS-CAB (37) UNKNOWN HEAVY TRUCK | |
| (0) O - NO INJURY (1) C - POSSIBLE INJURY (2) B - NON-INCAPACITATING INJURY (3) A - INCAPACITATING INJURY (4) K - FATAL (5) INJURED, SEVERITY UNKNOWN (6) DIED PRIOR TO ACCIDENT (7) NON-FATAL INJURY SEVERITY UNKNOWN (8) UNOCCUPIED VEHICLE (NOT APPLICABLE) (9) UNKNOWN | (38) TRACTOR & SEMI-TRAILER (SEMI) (39) TRUCK (OR SEMI) & FULL TRAILER(S) BUS (40) UNKNOWN BUS TYPE (41) SCHOOL BUS (42) INTERCITY BUS (BETWEEN CITIES) (43) TRANSIT BUS (INTRACITY) (44) STREETCAR (ON TRACKS) (68) TRAIN (CARS) (69) LOCOMOTIVE (ENGINE, SWITCHER) (99) UNKNOWN WHEELBASE (CM) | |
| | (999) UNKNOWN | 58 59 60 |

| Duplicate columns 1-8 from the previous card. | Module O V Fo | ormat <u>0 2</u> | (| OTHER | VEHICLE | OV-2 |
|---|---------------|------------------|------------------------|---------|---------|------|
| | | ORIGINAL SP | ECIFICATIONS | | | |
| Wheelbase | | cm | Front Overhang | | | cm |
| Court NA/aircht | | lea . | Rear Overhang | | 22 24 | om |
| Curb Weight | | kg kg | near Overllang | | 25 27 | cm |
| Average Track Width | | cm | Undeformed End Width | h (UEW) | 28 30 | cm |
| Overall Length | | cm | Engine Displacement | | _ • _ | L |
| | 16 18 | | | | 31 32 | |
| Overall Width (OAW) | 19 | cm | Engine: # of Cylinders | | 33 34 | |
| | | VEHICLE | DAMAGE | | | |
| | | | | | | |
| · | | | APPLICABLE | | | |
| | | ₩O, | | | | |
| | | | | | | |
| | | | | | | |
| | | | | | | |
| | | | | | | |
| | | | | | | |
| | | FRONTAL CR | ASH OVERLAP | | | |
| Round up for .5. 98 = : | | ۸ | Direct Damage Length (| (DDL) | 35 37 | cm |

Front-End Overlap (Percent) = DDL UEW

Vehicle Overlap (Percent) = DDL + 1/2 (OAW - UEW)
OAW

| Duplicate columns 1-8 from the previous card. Module V D Format 0 4 9 10 11 12 | VEHICLE DESCRIPTION | VD-1 |
|---|--|------|
| MAKE: <u>SATURN</u> MODEL: <u>SL2</u> , <u>4-DOOR</u> SEDAN | CARGO: NINE | |
| VIN / G 8 Z K 5 2 | ZXXZ | 29 |
| MANUFAC/BODY CODE $\frac{1}{30} + 827$ | STOLEN VEHICLE | |
| MAKE/MODEL CODE 3 7 0 1 38 | (0) NO (1) YES (8) NOT COLLECTED | 8 62 |
| MODEL YEAR $\frac{1}{39} \frac{9}{9} \frac{9}{42}$ | (9) UNKNOWN | |
| VEHICLE MASS (kg) $\frac{O}{43}$ $\frac{C}{C}$ / C g $\frac{4}{5}$ | BODY STRUCTURE (1) BODY & FRAME | 2 |
| ODOMETER (km) (ENTER 9'S IF UNKNOWN) (ENTER 8'S IF ELECTRONIC) ODOMETER (km) 49 ODOMETER (km) 60 60 61 | (2) UNITIZED (3) INTEGRAL-STUB FRAME (4) BODY & PLATFORM FRAME (E.G. VW BUG) | 63 |
| NUMBER OF OCCUPANTS (ENTER 9'S IF UNKNOWN) 56 | (5) PARTIALLY UNITIZED (7) OTHER: (9) UNKNOWN | |
| TRAVELING SPEED (km/h) 65 | TDANGMISSION | |
| (000) PARKED OR STOPPED (995) JUST STARTING UP (996) BACKING UP (997) SPEED NOT EXCESSIVE (BUT UNKNOWN) (998) SPEED EXCESSIVE (BUT UNKNOWN) (999) UNKNOWN | TRANSMISSION (0) NONE (1) AUTOMATIC (2) MANUAL (9) UNKNOWN | 4 |
| VEHICLE TYPE | LOCATION OF TRANSMISSION | |
| PASSENGER VEHICLE (11) 2-DOOR HARDTOP (NO UPPER B-PILLAR) (12) 2-DOOR SEDAN OR COUPE 60 61 | SELECTOR LEVER | 2 |
| (ANY UPPER B-PILLAR) (13) 4-DOOR HARDTOP (14) 4-DOOR SEDAN | (2) CONSOLE (3) COLUMN (7) OTHER: | 65 |
| (15) STATION WAGON (16) CONVERTIBLE (18) OTHER PASS. VEH. : (19) PASSENGER VEHICLE, TYPE UNKNOWN | (9) UNKNOWN | |
| MULTIPURPOSE PASSENGER VEHICLE (21) SMALL UTILITY (E.G. JEEP, SCOUT, BRONCO) | STEERING | 1 |
| (22) LARGE UTILITY (E.G. PANEL TRUCK, SUBURBAN) (23) VAN, SIZE UNKNOWN (24) VAN, SMALL (MINI) (25) VAN, LARGE (29) MPV, TYPE UNKNOWN (30) MOTOR HOME | (1) POWER (2) MANUAL (9) UNKNOWN | 66 |
| TRUCK (31) PICKUP TRUCK, UNKNOWN | BRAKES | |
| (32) PICKUP TRUCK, SMALL (DOWNSIZED) (33) PICKUP TRUCK, LARGE | (1) POWER (2) MANUAL (9) UNKNOWN | 67 |
| (99) UNKNOWN | \-\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ | |

| | | VEHICLE DESCRIPTION V | ′D-2 |
|---|------|--|--------------------------|
| TYPE OF BRAKES (1) DRUM, ALL WHEELS (2) DISC, FRONT WHEELS (3) DISC, ALL WHEELS (9) UNKNOWN | 3 | WHEELBASE <i>(cm)</i> (999) Unknown | <u>260</u> 76 77 78 |
| BRAKE ANTI-LOCK DEVICE (0) NONE INSTALLED (1) TWO-WHEEL (2) FOUR-WHEEL (7) EQUIPPED, UNKNOWN WHEELS (9) UNKNOWN AIR CONDITIONING IN VEHICLE (0) NO (1) YES (8) NOT COLLECTED (9) UNKNOWN | 8 70 | PLASTIC ANTI-LACERATIVE INNER LAYER GLASS EQUIPPED (0) NONE (1) WINDSHIELD (2) WINDSHIELD AND SIDE (7) OTHER (9) UNKNOWN | $\frac{\mathcal{O}}{79}$ |
| TYPE OF DRIVE (1) REAR WHEEL (2) FRONT WHEEL (3) FOUR WHEEL (4) ALL WHEEL DRIVE (9) UNKNOWN DUAL REAR WHEELS (0) NO (1) YES (9) UNKNOWN ORIGINAL TYPE OF RESTRAINT SYSTEM (1) ACTIVE BELT (2) PASSIVE BELT (3) AIRBAG (4) KNEE BOLSTERS (7) OTHER: (8) NOT APPLICABLE (NOT EQUIPPED) (9) UNKNOWN | | FIELD INVESTIGATOR INSTRUCTIONS: 1. INDICATE CRUSHED AREAS BY <u>OUT-LINING NEW PERIMETER</u> OF VEHICLE AND <u>SHADING THE DAMAGED AREAS</u> ON THE LARGE SKETCH ON PAGE VD-3. USE AS MANY SKETCHES AS NECESSARY TO COMPLETELY DESCRIBE THE DAMAGE. 2. ENTER THE DIMENSIONS ON THE SKETCH(ES) MEASURED TO THE POINT OF MAXIMUM PENETRATION BY THE OBJECT(S) CONTACTED. USE THE EXAMPLES BELOW AS A GUIDE. 3. ENTER THE THREE DIMENSIONS TO THE CENTER OF THE WHEELS (WHEELBASE, FRONT AND REAR OVERHANGS) ON BOTH SIDES OF THE CAR. 4. ADD OTHER DIMENSIONS AS NECESSARY TO COMPLETELY DESCRIBE THE DAMAGE. EXAMPLES: | |
| EQUIPPED WITH ROLL BAR (0) NO (1) YES (9) UNKNOWN TYPE OF ROOF (0) NONE (1) SOLID (2) T-TOP CLOSED (3) T-TOP OPEN (4) SUN ROOF CLOSED (5) SUN ROOF OPEN (6) CONVERTIBLE CLOSED (7) CONVERTIBLE OPEN (8) OTHER: (9) UNKNOWN | 74 | FRONT OR REAR ROOF (REFERENCE TO TOP OF DOOR SILL) OR WINDOW SILL) | |

Duplicate columns 1-8 from the previous card. Module V D Format 0 2 11 12

VEHICLE DESCRIPTION

VD-3

ORIGINAL SPECIFICATIONS

_260 cm Wheelbase

Front Overhang

Curb Weight

Rear Overhang

Undeformed End Width (UEW) $\frac{1}{28}$ $\frac{26}{30}$ cm

$$\frac{1}{2}$$
 $\frac{2}{2}$ $\frac{6}{2}$ cm

Overall Length

$$\frac{4}{16}$$
 $\frac{4}{5}$ cm

Engine Displacement


$$\frac{1}{31} \cdot \frac{9}{32}$$
 L

Overall Width (OAW) _____ 7 _ 0 cm

Engine: # of Cylinders

LKT = 24

VEHICLE DAMAGE

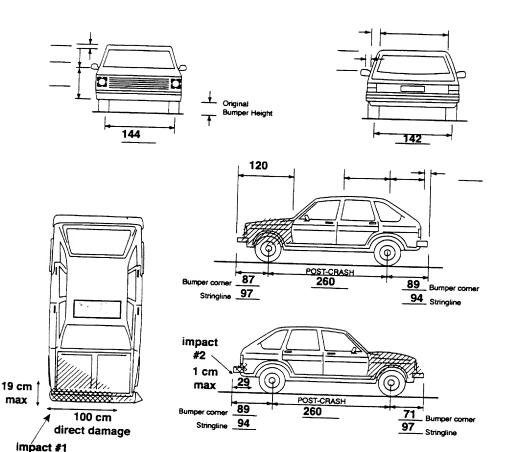

FRONTAL CRASH OVERLAP

Round up for .5. 98 = 98% or more Enter % overlap or "99" for missing or N/A. Direct Damage Length (DDL)

Front-End Overlap (Percent) = DDL

Vehicle Overlap (Percent) = $\frac{DDL + 1/2 \text{ (OAW - UEW)}}{OAW}$ $\frac{(60 + 47(176 - 126))}{170}$ $\frac{72}{40}$ %

| Duplicate columns 1-8 from the previous card. Module D A Format 0 2 11 12 DAMAGE DA-1 | | | | | | |
|---|--|--|--|--|--|--|
| PRIMARY | CASE VEHICLE PRIMARY CDC | CONTACTED VEHICLE ASSOCIATED CDC | | | | |
| EVENT NUMBER | | Well | | | | |
| IMPACT SPEED (km/h) | 999 | $\frac{9}{35} \frac{9}{36} \frac{8}{37}$ | | | | |
| ESTIMATED BY | | | | | | |
| CRUSH (cm) | $\frac{0}{18} \frac{1}{19} \frac{9}{20}$ | 99 8 39 40 41 | | | | |
| CDC #1 | $ \underbrace{O \ /}_{21} \cdot F \underbrace{D} \in W \cdot \underbrace{/}_{27} $ | 980000 | | | | |
| CDC #2 | 98-0000-d | 48 9 8.000.0 49 5.5 | | | | |
| Duplicate columns 1-8 Module D | A Format 0 3 11 12 | , | | | | |
| SECONDARY | CASE VEHICLE SECONDARY CDC | CONTACTED VEHICLE ASSOCIATED CDC | | | | |
| EVENT NUMBER IMPACT SPEED (km/h) | $\frac{2}{9 \frac{13}{6} F}$ | WA! 998 35 36 37 | | | | |
| ESTIMATED BY | <u> </u> | <u> </u> | | | | |
| CRUSH (cm) | $\frac{O}{18} \frac{O}{19} \frac{1}{20}$ | $\frac{99}{39} \frac{8}{40}$ | | | | |
| CDC #1 | 03.RBLE.1 | 98.0000.0 | | | | |
| CDC #2 | 98.000.0 28 | 98.0000.0 | | | | |
| Codes | - | | | | | |
| EVENT NUMBER | IMPACT SPEED ESTIMATOR | CRUSH | | | | |
| (8) NOT APPLICABLE (9) UNKNOWN | (2) DRIVER | (998) NOT APPLICABLE (NO VEHICLE/DAMAGE) | | | | |
| IMPACT SPEED | (3) POLICE (4) "CRASH" PROGRAM | (999) UNKNOWN | | | | |
| (998) NOT APPLICAE (999) UNKNOWN | (5) OTHER COMPUTER PROGRAM SPECIFY: (7) OTHER: (8) NOT APPLICABLE (NO VEHICLE/NO IMPACT) | CDC (9800000) NOT APPLICABLE (9900000) UNKNOWN | | | | |

DAMAGE DA-2 Duplicate columns 1-8 from the previous card. MAXIMUM SHEET METAL CRUSH (cm) (999) UNKNOWN 13 1 9 **FRONT** RIGHT SIDE 000 REAR LEFT SIDE <u>OO</u> <u>O</u> 000 ROOF **OTHER** CHRONOLOGICAL SEQUENCE OF DAMAGE/INJURY PRODUCING CRASH EVENTS FOR CASE VEHICLE DO YOU KNOW THIS TABLE TO BE IN CHRONOLOGICAL ORDER? NOTE: IF CHRONOLOGICAL ORDER IS UNKNOWN, EVENT ORDER IS OPTIONAL. (0) NO (1) YES

| EVENT NUMBER | IMPACT LOCATION (1) ON ROADWAY (2) SHOULDER/MEDIAN/GORE (3) ON ROADSIDE (4) OUTSIDE ROADSIDE RIGHT-OF-WAY (5) OTHER (6) OFF ROADWAY, LOC. UNK. (9) UNKNOWN | IMPACT CONFIGURATION FOR CODES, SEE TABLE ON PAGE DA-3. | OBJECT/VEHICLE CONTACTED FOR CODES, SEE TABLE ON PAGE DA-4. |
|-----------------|---|--|--|
| # 1 | 2 2 | <u> 17</u> | 95 95 |
| #2 | $\frac{2}{3}$ | 47 | <u>95</u> |
| #3 | 42 | | 46 |
| #4 | 47 | 49 | |
| #5 | 52 | | |
| #6 | 57 | | |
| #7 | 62 | 64 | 66 |

CODES FOR IMPACT CONFIGURATION

FRONT OF CASE VEHICLE

- (11) AND FRONT OF CONTACTED VEHICLE
- (13) AND SIDE OF CONTACTED VEHICLE
- (14) AND REAR OF CONTACTED VEHICLE
- (16) ENDSWIPED BY CONTACTED VEHICLE
- (17) AND OBJECT
- (19) AND UNKNOWN OTHER VEHICLE CONFIGURATION

LEFT SIDE OF CASE VEHICLE

- (21) AND FRONT OF CONTACTED VEHICLE (TYPE T)
- (22) AND FRONT OF CONTACTED VEHICLE (TYPE L)
- (23) AND SIDE OF CONTACTED VEHICLE (NOT SIDESWIPE)
- (24) AND REAR OF CONTACTED VEHICLE (TYPE T)
- (25) AND REAR OF CONTACTED VEHICLE (TYPE L)
- (26) SIDESWIPED BY CONTACTED VEHICLE
- (27) AND OBJECT
- (29) AND UNKNOWN OTHER VEHICLE CONFIGURATION

REAR OF CASE VEHICLE

- (31) AND FRONT OF CONTACTED VEHICLE
- (33) AND SIDE OF CONTACTED VEHICLE
- (34) AND REAR OF CONTACTED VEHICLE
- (36) ENDSWIPED BY CONTACTED VEHICLE
- (37) AND OBJECT
- (39) AND UNKNOWN OTHER VEHICLE CONFIGURATION

RIGHT SIDE OF CASE VEHICLE

- (41) AND FRONT OF CONTACTED VEHICLE (TYPE T)
- (42) AND FRONT OF CONTACTED VEHICLE (TYPE L)
- (43) AND SIDE OF CONTACTED VEHICLE (NOT SIDÉSWIPE)
- (44) AND REAR OF CONTACTED VEHICLE (TYPE T) (45) AND REAR OF CONTACTED VEHICLE (TYPE L)
- (46) SIDESWIPED BY CONTACTED VEHICLE
- (47) AND OBJECT
- (49) AND UNKNOWN OTHER VEHICLE CONFIGURATION

OTHER

- (57) VEHICLE TO OBJECT
- (58) VEHICLE TO VEHICLE
- (59) VEHICLE TO VEHICLE, CONFIGURATION UNKNOWN

ROLLOVER

- (61) LESS THAN 360°
- (62) 360° OR MORE
- (69) DETAILS UNKNOWN

UNKNOWN

...

(99) IMPACT TYPE UNKNOWN

CODES FOR VEHICLE/OBJECT CONTACTED

VEHICLE/OBJECT GROUPS

- NO OBJECT (00)
- (01) (39) PASSENGER VEHICLE & TRUCK
- (40) (69) OTHER VEHICLE
- (70) (76) PEDESTRIAN & ON-ROADWAY OBJECT
- (77) (97) OFF-ROADWAY OBJECT
- OTHER (DESCRIBE)
- UNKNOWN (99)

PASSENGER VEHICLE

- (02) LARGE
- (03) LIMOUSINE
- (17) PICKUP
- (20) UNKNOWN PASSENGER VEHICLE BODY
- (24) SUB-MINI
- (25) MINI
- (26) SUB-COMPACT
- (27) COMPACT
- (28) INTERMEDIATE
- (29) FULL

SIZE

WHEELBASE

| < 2286 mm (< 90°) |
|--------------------------------|
| 2286 - 2412 mm (90" - 94.9") |
| 2413 - 2539 mm (95° - 99.9°) |
| 2540 - 2666 mm (100" - 104.9") |
| 2667 - 2793 mm (105" - 109.9") |
| 2794 - 2920 mm (110° - 114.9°) |
| 2921 - 3174 mm (115" - 124.9") |
| > 3175 mm (> 125°) |
| |

MULTIPURPOSE PASSENGER VEHICLE

- (11) SMALL VAN (MINI)
- (12) PICKUP
- (14) SMALL UTILITY (WHEELBASE LESS THAN 107". E.G. JEEP, BRONCO)
- (15) LARGE UTILITY (WHEELBASE MORE THAN 107". E.G. PANEL TRUCK, SUBURBAN)
- (16) PICKUP TRUCK WITH CANOPY/SHELL COVER
- (17) PICKUP CAR WITH CANOPY/SHELL COVER
- (21) MOTOR HOME
- (22) PICKUP TRUCK WITH SLIDE-IN CAMPER
- (23) PICKUP CAR WITH SLIDE-IN CAMPER
- (31) CHASSIS-MOUNTED CAMPER

TRUCK

- (11) SMALL VAN (E.G. ECONOLINE)
- (12) PICKUP TRUCK
- (13) UNKNOWN LIGHT TRUCK
- (15) LARGE UTILITY (E.G. PANEL TRUCK, SUBURBAN)
- (16) PICKUP TRUCK WITH CANOPY/SHELL COVER
- (22) PICKUP TRUCK WITH SLIDE-IN CAMPER
- (30) UNKNOWN TRUCK TYPE
- (31) CHASSIS-MOUNTED CAMPER
- (33) DELIVERY VAN (WALK-IN)
- (34) STRAIGHT TRUCK
- (35) TRUCK-TRACTOR (BOBTAIL)
- (36) CHASSIS-CAB
- (37) UNKNOWN HEAVY TRUCK
- (38) TRACTOR & SEMI-TRAILER (SEMI)
- (39) TRUCK (OR SEMI) & FULL TRAILER(S)

BUS

- (40) UNKNOWN BUS TYPE
- (41) SCHOOL BUS
- (42) INTERCITY BUS (BETWEEN CITIES)
- (43) TRANSIT BUS (INTRACITY)
- _ (44) STREETCAR (ON TRACKS)

MOTORCYCLE

- (50) UNKNOWN MOTORCYCLE TYPE
- (51) 1 75 cc (52) 76 125 cc
- (53) 126 250 cc
- (54) 251 500 cc
- (55) 501 750 cc
- (56) 751 cc +
- (57) 3-WHEELS (OR WITH SIDECAR)

SPECIAL PURPOSE VEHICLE

- (60) UNKNOWN/OTHER SPECIAL VEHICLE (DESCRIBE)
- (61) SNOWMOBILE
- (62) ATV (ALL TERRAIN VEHICLE)
- (63) AMPHIBIOUS VEHICLE
- (64) FARM VEHICLE
- (65) CONSTRUCTION VEHICLE
- (66) TRAILER, PRIVATE (CAMPER)
- (67) TRAILER, COMMERCIAL (CARGO)
- (68) TRAIN (CARS)
- (69) LOCOMOTIVE (ENGINE, SWITCHER)

OBJECT

- (70) PEDESTRIAN
- (71) BICYCLIST, OTHER PEDALCYCLIST
- (72) PEDESTRIAN CONVEYANCE (E.G. PERSON RIDING ANIMAL CARTI
- (73) LARGE ANIMAL
- (74) FALLEN OBJECT (E.G. OBJECT DISLODGED FROM OTHER VEHICLE, FALLEN TREE, ROCKS)
- (75) ROCKS
- (76) CONSTRUCTION EQUIPMENT (EXCLUDING (65))
- (77) SIGN POST, UTILITY POLE, TREE (78) DITCH
- (79) EMBANKMENT, SNOWBANK, RR TRACKS RR X
- (80) GROUND (ROLLOVER ONLY)
- (81) CURB (DAMAGE PRODUCING IMPACTS ONLY)
- (82) CULVERT
- (83) FENCE
- (84) HYDRANT, SHORT POST, STUMP
- (85) SMALL POST/TREE, RURAL MAIL BOX, MILE MARKER, DELINEATOR
- (86) BUILDING
- (87) PIER, PILLAR, BRIDGE SUPPORT
- (88) ABUTMENT, RETAINING WALL
- (89) BRIDGE RAIL
- (90) GUARD RAIL, LEADING SECTION
- (91) GUARD RAIL, MIDDLE OR UNKNOWN
- (92) GUARD RAIL, TRAILING SECTION (93) GUARD POST (TIMBER, METAL, CONCRETE)
- (94) CABLE, FENCE BARRIER
- (95) CONCRETE BARRIER (MEDIAN)
- (96) IMPACT ATTENUATOR
- (97) BREAKAWAY FEATURES

| Duplicate columns 1-8 Module C from the previous card. 9 1 | R Format 0 1 12 | | H RECONSTRUCT FAV | - |
|--|----------------------------|----------------------|----------------------|----------------------|
| | | PRIMARY IMPACT | | CONDARY IMPACT |
| | CASE VEHICLE | CONTACTED VEHICLE | CASE VEHICLE | CONTACTED VEHICLE |
| EVENT NUMBER | 13 | | <u>2</u> | |
| ΔV (km/h) TOTAL | <u>Q</u> <u>2</u> <u>1</u> | <u>8</u> — 32 33 34 | 48 49 50 | 66 67 68 |
| LONGITUDINAL | <u>-013</u> | 35 38 | 9 | 69 72 |
| LATERAL* | -015 | 8- | 9 | <u> </u> |
| NOTE: THESE ΔV COMPONENTS MUST INCLUDE SIGN. | 21 24 | 39 42 | 55 58 | 73 76 |
| EXAMPLES: 10 km/h = ± <u>0 1 0</u> -7 km/h = ± <u>0 0 7</u> | | | | |
| ENERGY DISSIPATED BY CRUSH (ஏ) | <u>0</u> 0 49 28 | 8 /43 46 | 9 62 | 77 80 |
| RECONSTRUCTION | | | | |
| (01) RECONSTRUCTED, UNKNOWN CONFIDENCE LEVEL | 22 | | <u>O</u> \$ | |
| (21) RECONSTRUCTED, LOW | 29 30 | | 63 64 | |
| CONFIDENCE LEVEL (22) RECONSTRUCTED, MODERATE | | | | · |
| CONFIDENCE LEVEL (23) RECONSTRUCTED, HIGH CONFIDENCE LEVEL | | | | |
| NOT RECONSTRUCTED BECAUSE | | | | |
| (02) INSUFFICIENT DATA (03) EXCESSIVE UNDERRIDE/ OVERRIDE | | | | |
| (04) ROLLOVER (05) VAULTING | | | | |
| (06) OTHER TRAVEL IN MORE THAN ONE PLANE | | | | |
| (07) NON-HORIZONTAL FORCE (08) SIDESWIPE-TYPE DAMAGE | | | | |
| (09) YIELDING OBJECT (10) OTHER: | | | | |
| (11) AT LEAST ONE VEHICLE BEYOND SCOPE | | | | |
| (12) OTHER VEHICLE NOT INSPECTED | | | | |
| MODE | | | | |
| (1) CDC ONLY (2) CDC & DETAILED DAMAGE (3) TRAJECTORY & CDC (4) TRAJECTORY & CDC & DETAILED DAMAGE (5) NOT RECONSTRUCTED | 31 | | <u>5</u> | |
| COMPUTER PROGRAM SPECIFY: LA 14 STAPELL | | | | |

| Duplicate columns 1-8 Module C F from the previous card. 9 1 | R Format 0 2 | | H RECONSTRUCT REBS | TION CR-2 | | | |
|--|------------------------------|----------------------|-------------------------------|----------------------|--|--|--|
| | CASE VEHICLE P | | CASE VEHICLE SECONDARY IMPACT | | | | |
| | CASE VEHICLE | CONTACTED VEHICLE | CASE VEHICLE | CONTACTED VEHICLE | | | |
| EVENT NUMBER | 13 | | <u>2</u> | | | | |
| EBS (km/h) TOTAL | <u>02/</u> 14 15 16 | 32 33 34 | 48 49 50 | 66 67 68 | | | |
| LONGITUDINAL* | $\frac{-0}{17} \frac{1}{20}$ | 35 38 | 51 54 | 69 72 | | | |
| LATERAL* | -015 | 8- | 9 | 8- | | | |
| NOTE: THESE EBS COMPONENTS MUST INCLUDE SIGN. | 21 24 | 39 _ 42 | 55 58 | 73 76 | | | |
| EXAMPLES: 10 km/h = ± <u>0</u> <u>1</u> <u>0</u> -7 km/h = <u>-</u> <u>0</u> <u>0</u> <u>7</u> | | | | | | | |
| ENERGY DISSIPATED BY CRUSH (ki) | <u>0</u> <u>0</u> <u>49</u> | 8 - 46 | 4 <u> </u> | 8 — 80 | | | |
| RECONSTRUCTION | | | | | | | |
| (01) RECONSTRUCTED, UNKNOWN CONFIDENCE LEVEL | <u>2</u> 2 | | 08 | | | | |
| (21) RECONSTRUCTED, LOW CONFIDENCE LEVEL (22) RECONSTRUCTED, MODERATE CONFIDENCE LEVEL (23) RECONSTRUCTED, HIGH CONFIDENCE LEVEL | | | 3 3 | | | | |
| NOT RECONSTRUCTED BECAUSE | | | | | | | |
| (02) INSUFFICIENT DATA (03) EXCESSIVE UNDERRIDE/ OVERRIDE (04) ROLLOVER (05) VAULTING (06) OTHER TRAVEL IN MORE THAN ONE PLANE (07) NON-HORIZONTAL FORCE (08) SIDESWIPE-TYPE DAMAGE (09) YIELDING OBJECT (10) OTHER: (11) AT LEAST ONE VEHICLE BEYOND SCOPE (12) OTHER VEHICLE NOT INSPECTED | | | | | | | |
| MODE | | | | | | | |
| (1) CDC ONLY (2) CDC & DETAILED DAMAGE (3) TRAJECTORY & CDC (4) TRAJECTORY & CDC & DETAILED DAMAGE (5) NOT RECONSTRUCTED | 31 | | 5 65 | | | | |
| COMPUTER PROGRAM SPECIFY: WINSM 4317 | | | | | | | |

Duplicate columns 1-8 from the previous card.

Module <u>C</u> <u>R</u> Format <u>0</u> <u>3</u>

CRASH RECONSTRUCTION

CR-3

NOTES:

- 1. ENTER CRASH RECONSTRUCTION DAMAGE MEASUREMENTS IN CENTIMETERS.
- 2. MEASURE C $_1$ TO C $_6$ FROM DRIVER TO PASSENGER SIDE IN FRONT OR REAR IMPACTS, REAR TO FRONT IN SIDE IMPACTS.

CASE VEHICLE

LOCATOR


3. D IS POSITIVE IF MEASURED TO A POINT FORWARD OF OR TO THE RIGHT OF THE CG.

4. USE THE CENTER OF THE WHEELBASE AS THE CG.

Locate the end of the damage with respect to the vehicle longitudinal center line, or an undamaged axle for side impacts.

| Specific Impact No. | Location of Direct Damage | Location of Field L |
|---------------------|---------------------------|---------------------|
| | BEGINS AT REBC | RC TO BC |
| | | |
| | | |

C6 13 MAX Crush

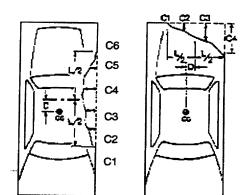

DL _____

UDL

PLANE:

- (1) Bumper
- (2) Above Bumper
- (3) Sill
- (4) Above Sill
- (5) Other ____ (9) Unknown

CRUSH PROFILE IN CENTIMETERS

NOTE: Each line in the table below is a separate record (card)

Duplication

| | | | separate reci | ord (card). | Du | plicate col | umns 1 - 1 | 2 for each | complete | d line |
|---------------------------------|---------------------------|---|---|---|---|---|--|--|---|--|
| Plane of Impact C-Measur. | Direct Length (DDL) | Damage Max Crush | Field L | C ₁ | C ₂ | C ₃ | C ₄ | C ₅ | C ₆ | ±D |
| 1 | 100 | 37 | 109 | 20 | 21 | 22 | 27 | 32 | 36 | -13 |
| É | , | ・フ | | 7 | 4 | 2 | 2 | 4 | 7 | |
| | | 28 | | 13 | 17 | 20 | 25 | 28 | 29 | |
| er Cour | 1 | -10 | | -10 | -10 | -10 | -10 | -10 | -10 | |
| | Ter | 19 | | 3 | 7 | 10 | 15 | 18 | 19 | |
| | 100 | 019 | 109 | 003 | 007 | | 015 | | 019 | -13 |
| 14 | 15 16 17 | 18 19 20 | 21 22 23 | 24 25 26 | 27 28 29 | 30 31 32 | 33 34 35 | 36 37 38 | 39 40 41 | 42 43 44 45 |
| | | | | | | | | | | |
| | | | | | | | | | | |
| - | | | | | | | | | | |
| | | | | | | | | | | |
| | | | | | | | | | | |
| | Plane of Impact C-Measur. | Plane of Impact C-Measur. Length (DDL) / Court | Plane of Impact C-Measur. Length (DDL) Crush 166 37 27 27 27 196 019 | Plane of Impact C-Measur. IOO 37 IOO | Plane of Impact C-Measur. Direct Damage Length (DDL) Max Crush Field L C1 1 166 37 109 20 28 .7 7 28 -10 -10 19 3 106 019 109 003 | Direct Damage C1 C2 Of Impact Length Max Crush L C1 C2 Of Impact C-Measur. ODL Crush C1 C2 Of Impact C2 C2 C3 C4 Of Impact C3 C4 C4 C2 Of Impact C4 C4 C4 C4 Of Impact C4 C4 C4 Of Impact C4 C4 C4 Of Impact C4 | Plane of Impact C-Measur. Direct Damage Length (DDL) Max Crush Field L C1 C2 C3 1 166 37 109 20 21 22 2 7 4 2 2 13 17 20 2 -10 -10 -10 -10 19 3 7 10 100 019 109 003 007 010 | Plane of Impact C-Measur. Direct Damage Length (DDL) Crush Field C1 C2 C3 C4 | $\begin{array}{c ccccccccccccccccccccccccccccccccccc$ | Plane of Impact C-Measur. Direct Damage Length (DDL) Crush Field C1 C2 C3 C4 C5 C6 |

| Duplicate columns 1-8 | |
|-------------------------|--|
| from the previous card. | |

Module <u>C</u> <u>R</u> Format <u>0</u> <u>4</u> 10 11 12

CRASH RECONSTRUCTION

CR-4

NOTES:

- 1. ENTER CRASH RECONSTRUCTION DAMAGE MEASUREMENTS IN CENTIMETERS.
- 2. MEASURE C $_{\rm 1}$ TO C $_{\rm 6}$ FROM DRIVER TO PASSENGER SIDE IN FRONT OR REAR IMPACTS, REAR TO FRONT IN SIDE IMPACTS.

OTHER VEHICLE

LOCATOR

- 3. D IS POSITIVE IF MEASURED TO A POINT FORWARD OF OR TO THE RIGHT OF THE CG.
- 4. USE THE CENTER OF THE WHEELBASE AS THE CG.


Locate the end of the damage with respect to the vehicle longitudinal center line, or an undamaged axle for side impacts.

| Specific Impact No. | Location of Direct Damage | Location of Field L |
|---------------------|---------------------------|---------------------|
| | | |
| | | |
| | | |



PLANE:

- (1) Bumper
- (2) Above Bumper
- (3) Sill
- (4) Above Sill
- (5) Other_
- (9) Unknown

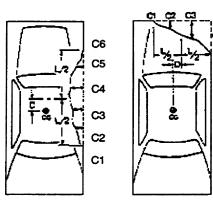

DL

UDL ____

CRUSH PROFILE IN CENTIMETERS

| | NOTE: Each line in the table below is a separate record (card). | | | rd). Duplicate columns 1 - 12 for each completed line. | | | | d line. | | | |
|------------------------------|---|---------------------------|------------------------|--|----------------|----------------|----------------|----------------|----------------|----------------|-------------|
| Specific Impact Number | Plane of Impact C-Measur. | Direct Length (DDL) | Damage Max Crush | Field L | C ₁ | C ₂ | C ₃ | C ₄ | C ₅ | C ₆ | ±D |
| | | | | | | | | | | | |
| | | | | OT APP | LICABI | | | | | | |
| | | | | | | | | | | | |
| | | | | | | | | | | | |
| | | | | | | | | | | | |
| 1 | | | | | | | | | | | |
| 13 | 14 | 15 16 17 | 18 19 20 | 21 22 23 | 24 25 26 | 27 28 29 | 30 31 32 | 33 34 35 | 36 37 38 | 39 40 41 | 42 43 44 45 |
| | | | | | | | | | | | |
| | | | | | | | | | | | |
| | | | | | | | | | | | |
| | | | | | | | | | | | |
| 2 | | | | | | | | | | | |

| Duplicate columns 1-8 from the previous card. Module W T 9 10 | Format <u>0</u> | | WHEELS AND TIRES WT-1 |
|---|----------------------|--|--|
| WHEELSDAMAGED (0) NO (1) YES (9) UNKNOWN | LF RF RR LR | 12 O O O 16 | SIZE (NOT DOT CODE. IF UNKNOWN, USE 9'S) LF P 1 8 5 6 5 R 1 5 RF |
| TIRE TREAD TYPE (1) REGULAR (2) SNOW (3) SLICKS (4) ALL WEATHER (MS) (7) OTHER: (9) UNKNOWN | LF RF RR LR | > ¹⁷ > > ₂ | LR |
| CARCASS CONSTRUCTION (1) BIAS (2) BELTED BIAS (3) RADIAL (4) ELLIPTICAL (5) HI PRESSURE SPARE (6) SPACE SAVER SPARE (7) OTHER: (9) UNKNOWN | LF RF RR LR | كم الم مما معام م | |
| IF VEHICLE IS EQUIPPED WITH DUAL WHEELS, COMPLETE FOR OUTER WHEELS AND MAKE NOTES ON INNER WHEELS. NOTES: | | | |

| Duplicate columns 1-8 Module F T Format (from the previous card. 9 10 1 |) <u>1</u> 1 12 | FUEL AND FUEL TANKS | FT-1 |
|--|--------------------|---|---------------|
| TYPE OF PROPULSIVE FUEL (1) GASOLINE (2) DIESEL OIL (3) LPG (4) ELECTRIC (7) OTHER: (9) UNKNOWN | / 13 | AUXILIARY TANK TYPE (1) OEM TANK (2) AFTER MARKET TANK (8) NOT APPLICABLE (NOT EQUIPPED) (9) UNKNOWN | 21 |
| MAIN TANK LOCATION | <u>32</u> 2 | AUXILIARY TANK LOCATION | 88f 22 24 |
| MAIN FILLER CAP LOCATION | 17 13 19 | AUXILIARY FILLER CAP LOCATION | 88 f 25 27 |
| MAIN TANK MATERIAL | 9 | AUXILIARY TANK MATERIAL | 8 28 |
| | | | |

TANK AND FILLER CAP LOCATION CODES

FIRST DIGIT (LONGITUDINAL)

- (1) BEHIND KICK-UP (2) IN KICK-UP
- (3) BETWEEN KICK-UP & COWL
- (4) FORWARD OF COWL
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

SECOND DIGIT (LATERAL)

- (1) LEFT OF FRAME
- (2) WITHIN FRAME OR CENTERED
- (3) RIGHT OF FRAME
- (4) DUAL, RIGHT & LEFT TANKS
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

THIRD DIGIT (VERTICAL)

- (1) BELOW FRAME
- (2) WITHIN FRAME OR CENTERED
- (3) ABOVE FRAME
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

TANK MATERIAL CODES

- (1) STEEL
- (2) ALUMINUM
- (3) PLASTIC
- (7) OTHER
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

| Duplicate columns 1-8 |
|-------------------------|
| from the previous card. |

| Module <u>F</u> | L | Format 0 | _1 |
|-----------------|----|----------|----|
| ^ | 40 | | |

FUEL LEAKAGE

FL-1

DID FUEL LEAKAGE RESULT FROM A CRASH EVENT

(0) NO KNOWN LEAKAGE SKIP PAGE.

(1) YES COMPLETE PAGE.



| | I | 11 | 111 | IV | V | |
|----------------|----------------------|---------------------|-------------------|-----------------------|---------------------|-----------------|
| LEAK NUMBER | LEAKING COMPONENT | COMPONENT SOURCE | TYPE OF DAMAGE | SEVERITY OF DAMAGE | LOCATION OF LEAK | EVENT NUMBER |
| #1 | 14 15 | | | | | 21 |
| #2 | 22 23 | | _ | | | 29 |
| #3 | 30 31 | | | _ | | 37 |
| #4 | 38 39 | | | _ | | 45 |
| #5 | 46 47 | | | | | 53 |

LEAKING COMPONENT

TANK AREA

- (11) MAIN FUEL TANK (INCLUDING VAPOR RECOVERY DOME)
- (12) AUXILIARY FUEL TANK
- (13) MAIN TANK FILLER TUBE
- (14) MAIN TANK CAP (GAS CAP)
- (15) AUXILIARY TANK FILLER TUBE
- (16) AUXILIARY TANK CAP (GAS CAP)
- (19) TANK AREA, DETAILS UNKNOWN

DELIVERY SYSTEM

- (21) FUEL FEED LINE (MAIN TANK TO FUEL PUMP)
- (22) FUEL FEED LINE (AUXILIARY TANK TO FUEL PUMP)
- (23) FUEL RETURN LINE (FUEL PUMP TO TANK)
- (24) INLINE FUEL FILTER
- (25) FUEL LINE (PUMP TO CARBURETOR OR INJECTOR PUMP)
- (26) CARBURETOR TO INJECTOR PUMP
- (27) FUEL PUMP
- (29) DELIVERY SYSTEM, DETAILS UNKNOWN

EVAPORATIVE EMISSION CONTROL SYSTEM

- (31) ATMOSPHERIC VENT PIPE (NON-EEC EQUIPPED)
- (32) EEC PIPE (VAPOR CANISTER TO CARBURETOR)

EEC SYSTEM (CONTINUED)

- (33) VAPOR RECOVERY HOSES (CANISTER TO CARBURETOR)
- (34) LIQUID-VAPOR SEPARATOR (UNLESS PART OF TANK)
- (35) CANISTER
- (39) EEC SYSTEM, DETAILS UNKNOWN
- (49) ENGINE COMPARTMENT, COMPONENT UNKNOWN
- (99) COMPONENT UNKNOWN

II COMPONENT SOURCE

- (1) OEM
- (2) AFTER MARKET
- (9) UNKNOWN

III TYPE OF DAMAGE

- (1) DENTED/CRUSHED
- (2) PUNCTURED
- (3) RUPTURED
- (4) SEVERED/GROSS TEARS
- (5) DISCONNECTED/DEFEATED
- (9) UNKNOWN

IV SEVERITY OF DAMAGE

- (1) MINOR
- (2) MODERATE
- (3) SEVERE
- (4) DISCONNECTED/DEFEATED
- (9) UNKNOWN

V LOCATION OF LEAK

FIRST DIGIT (LONGITUDINAL LOCATION)

- (1) F, FORWARD OF COWL
- (2) P, BETWEEN COWL & REAR BULKHEAD
- (3) B, BEHIND REAR BULKHEAD
- (4) Y, F, & P
- (5) Z, P, & B
- (6) D, DISTRIBUTED (F, P & B)
- (9) UNKNOWN

SECOND DIGIT (LATERAL LOCATION)

- (1) L, LEFT
- (2) C, CENTER
- (3) R, RIGHT
- (4) Y, LEFT CENTER (L & C)
- (5) Z, RIGHT CENTER (R & C)
- (6) D, DISTRIBUTED (F, P & B)
- (9) UNKNOWN

| Duplicate columns 1-8 Module F R Format 0 11 11 11 11 11 11 11 11 11 11 11 11 1 | | Fire 1 | FR-1 |
|---|-----|--|------|
| WAS THERE FIRE IN (0) NO SKIP PAG (1) YES COMPLE | GE. | CASE VEHICLE? | |
| DID FIRE START IN CASE VEHICLE? (0) NO (1) YES (9) UNKNOWN | 14 | SEVERITY OF FIRE DAMAGE (1) MINOR (2) MODERATE (3) SEVERE (9) UNKNOWN | 16 |
| FLAME PROPOGATION RATE (1) RAPID/EXPLOSIVE (2) SLOW/MODERATE (9) UNKNOWN | 15 | DID AN INJURY TO CASE VEHICLE OCCUPANT RESULT FROM FIRE IN OR ON CASE VEHICLE? (0) NO (1) YES (9) UNKNOWN | 17 |


PROVIDE NOTES IF FIRE OCCURRED.

| Duplicate columns 1-8 from the previous card. Module E D 10 | Format 0 1 12 | EXTERIOR DAMAGE | ED-1 |
|--|---|---|-------|
| HOOD PERFORMANCE | | STEERING COL FLEXIBLE COUPLING | |
| FOR THE FOLLOWING, USE CODES: | | (0) NONE | |
| (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN | | (1) FLEXIBLE MATERIAL (2) POT (3) SINGLE U-JOINT (4) DOUBLE U-JOINT (5) FLEXIBLE CABLE (6) COMBINATION OF ABOVE (CIRCLE EACH) | 9 26 |
| HOOD LATCH(ES)RE | LEASED O | (7) OTHER: (8) EQUIPPED, TYPE UNKNOWN (9) UNKNOWN, IF EQUIPPED | |
| -DA | $ \begin{array}{c c} \text{LEASED} & \underline{\underline{O}} \\ \text{MAGED} & \underline{\underline{O}} \\ \end{array} $ | COUPLINGDAMAGED | 9 |
| AAL- | MMED 5 | (USE CODES FROM <u>HOOD</u> PERFORMANCE) -SEPARATED | 9 |
| HOOD HINGESLEFT, DAM | AAGED | (COMPLETE) | 28 |
| | ARATED 17 ARATED 17 ARAGED 6 18 | | |
| -RIGHT, DAM | IAGED 6 | ENG COMPART TELESCOPING UNIT | |
| | ARATED 18 MPLETE) 19 | TYPE OF UNIT (00) NONE INSTALLED (01) - (07) SEE UNITS ON PAGE ED-2 (88) NOT COLLECTED | 8 8 |
| HOOD REMAINED ON VEHICLE | 1 20 | (97) OTHER: | 25 50 |
| REAR EDGE OF HOODELE | VATED 1 | ORIGINAL LENGTH (mm) | |
| -CONTACTED WIND | SHIELD 22 | F (OR H): | |
| -PENETRATED WINDS | SHIELD & | TELESCOPED LENGTH (mm) | |
| HOOD LATCH LOCATION | | G: | |
| (1) FRONT OF VEHICLE (2) COWL AREA | / | DIFFERENCE (mm) | |
| (3) SIDE (8) NOT APPLICABLE (9) UNKNOWN | 24 | F (OR H) - G | |
| ENGINE OR TRANSMISSION MOUI SEPARATION (COMPLETE) (0) NO (1) YES (9) UNKNOWN | NT <u>Ø</u> | (IF LESS THAN 15mm, ENTER *000*.) (888) NOT COLLECTED (991) NOT MEASURED/NO COMPRESSION (992) COMPRESSED, AMOUNT UNKNOWN (993) DEVICE EXTENDED (997) UNABLE TO BE MEASURED (998) NOT APPLICABLE (NOT EQUIPPED) (999) UNKNOWN | 8 8 8 |

| | | EXTERIOR DAMAGE | ED-2 |
|---|--------------------------|--|-------------------|
| LEFT-SIDE BODY MOUNT DID BODY MOUNT SEPARATE? (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN | 8 34 | LEFT DOORS HOW DID DOORS OPEN DURING COLLISION? | |
| LEFT PILLARS PILLARS SEPARATED COMPLETELY - USE CODES: (0) NO (1) YES (4) NO SEPARATION, BUT DAMAGED (8) NOT APPLICABLE (NOT EQUIPPED) (9) UNKNOWN | | USE CODES: (0) DOOR DID NOT OPEN OPENED BECAUSE OF (1) HINGE AREA SEPARATION (2) DOOR-LATCH SEPARATION (3) LATCH-STRIKER SEPARATION (4) STRIKER-PILLAR SEPARATION (5) BODY DISTORTION (6) COMBINATION OF ABOVE (CIRCLE EACH) (7) OPENED, REASON UNKNOWN | |
| -A-PILLAR, UPPER | _ <u>O</u> | (8) NOT APPLICABLE <i>(NO DOOR)</i> (9) UNKNOWN | |
| LOWER | <i>Q</i> 36 | -FRONTREAR | \frac{\omega}{43} |
| -B-PILLAR, UPPER | <u>Q</u> | DOORS JAMMED CLOSED- | |
| LOWER | <u>O</u> 38 | USE CODES: (0) NO (1) YES (8) NOT APPLICABLE (NO DOOR) | |
| -C-PILLAR, UPPER | 39 | (9) UNKNOWN -FRONT | |
| LOWER | <u>O</u> | -REAR | 45 |
| -D-PILLAR, UPPER | <u>₹</u> | ·- ·· | 46 |
| LOWER | <i>8</i> 42 − | | |
| | | - | |


| | | EXTERIOR DAMAGE | ED-3 |
|---|----------|--|-------------|
| | | OTHER REAR DAMAGE | |
| REAR DOOR REAR DOOR TYPE (0) NO DOOR (INCLUDES PICKUPS) (1) HATCHBACK (2) ONE-WAY TAILGATE (3) TWO-WAY TAILGATE (4) CLAMSHELL/DISAPPEARING TAILGATE (5) SINGLE DOOR | <u>O</u> | WAS PARTITION TO LUGGAGE AREA DAMAGED DURING COLLISION? (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN SPARE TIRE | <u></u> |
| (6) DOUBLE DOOR (9) UNKNOWN | | (0) NO SPARE TIRE | 8 |
| Hatchback One-way | | (1) NOT ATTACHED BEFORE COLLISION (2) ATTACHED, NOT SEPARATED IN COLLISION (3) ATTACHED, SEPARATED DUE TO COLLISION (8) NOT COLLECTED (9) UNKNOWN | 51 |
| Two-way or or | | TRAILER HITCH TYPE (0) NO HITCH | <u>Ô</u> |
| Clamshell | | BALL-AND-SOCKET TYPES (1) TEMPORARY FRAMEWORK (E.G. | 52 |
| Single door | | RENTAL CLAMP-ON) (2) BUMPER-MOUNT ONLY (E.G. LIGHT TRUCK) (3) BUMPER-AND-FRAME (BUT NON-EQUALIZING) (4) LOAD EQUALIZING | -50- |
| Double door | | OTHER TYPES | |
| HOW DID DOOR OPEN DURING COLLISION? | | (5) RING-AND-PINTLE (6) FIFTH-WHEEL (INCL. P/U) (7) OTHER (E.G. CLEVIS-AND-PIN) | |
| (0) DOOR DID NOT OPEN | 8 | (8) EQUIPPED, TYPE UNKNOWN (9) UNKNOWN IF EQUIPPED | |
| (1) HINGE AREA SEPARATION (2) DOOR-LATCH SEPARATION (3) LATCH-STRIKER SEPARATION (4) STRIKER-PILLAR SEPARATION (5) BODY DISTORTION (6) COMBINATION OF ABOVE (CIRCLE EACH) (7) OPENED, REASON UNKNOWN (8) NOT APPLICABLE (NO DOOR) (9) UNKNOWN DOOR JAMMED CLOSED (0) NO (1) YES (8) NOT APPLICABLE (NO DOOR) (9) UNKNOWN | 48 | TRAILER TYPE (AT TIME OF COLLISION) (0) NO TRAILER (1) TRAVEL-TRAILER/CAMPER (2) MOBILE HOME (3) BOAT/SNOWMOBILE/ATV TRAILER (4) UTILITY TRAILER (5) TOWED CAR (7) OTHER: (8) TRAILER, TYPE UNKNOWN (9) UNKNOWN | <u>O</u> 53 |

| | | Exterior Damage E | ED-4 |
|--|----------------|--|-------------------------|
| RIGHT-SIDE BODY MOUNT DID BODY MOUNT SEPARATE? (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN | 54 | RIGHT DOORS HOW DID DOORS OPEN DURING COLLISION? USE CODES: | |
| RIGHT PILLARS PILLARS SEPARATED COMPLETELY - USE CODES: (0) NO (1) YES (4) NO SEPARATION, BUT DAMAGED (8) NOT APPLICABLE (NOT EQUIPPED) (9) UNKNOWN | | (00) DOOR DID NOT OPEN OPENED BECAUSE OF (01) HINGE AREA SEPARATION (02) DOOR-LATCH SEPARATION (03) LATCH-STRIKER SEPARATION (04) STRIKER-PILLAR SEPARATION (05) BODY DISTORTION (06) COMBINATION OF ABOVE (CIRCLE EACH) (07) OPENED, REASON UNKNOWN (11) VAN RIGHT-REAR DOOR OPENED (ANY MECHANISM) | |
| -A-PILLAR, UPPER | <u>O</u> 55 | (98) NOT APPLICABLE <i>(NO DOOR)</i> (99) UNKNOWN | 00 |
| LOWER | <u>Q</u> | -FRONT -REAR | S 64 |
| -B-PILLAR, UPPER | <u>O</u> 57 | | 65 66 |
| LOWER | <u>Ø</u> 58 | DOORS JAMMED CLOSED- USE CODES: (0) NO | |
| -C-PILLAR, UPPER | <u>Q</u> 59 | (1) YES (8) NOT APPLICABLE <i>(NO DOOR)</i> (9) UNKNOWN | |
| LOWER | <u>Ø</u> | -FRONT -REAR | |
| -D-PILLAR, UPPER | S 61 | | 68 |
| LOWER | <u>8</u> | VAN REAR DOOR TYPE (0) VAN, NO REAR DOOR (1) TRACK (SLIDING) - RIGHT SIDE (2) SINGLE-HINGED - RIGHT SIDE (3) DOUBLE-HINGED - RIGHT SIDE (4) TRACK (SLIDING) - RIGHT & LEFT SIDE (5) SINGLE-HINGED - RIGHT & LEFT SIDE (6) DOUBLE-HINGED - RIGHT & LEFT SIDE (7) TRACK AND HINGED COMBINATION (8) NOT APPLICABLE (NOT A VAN) (9) UNKNOWN | & ® |

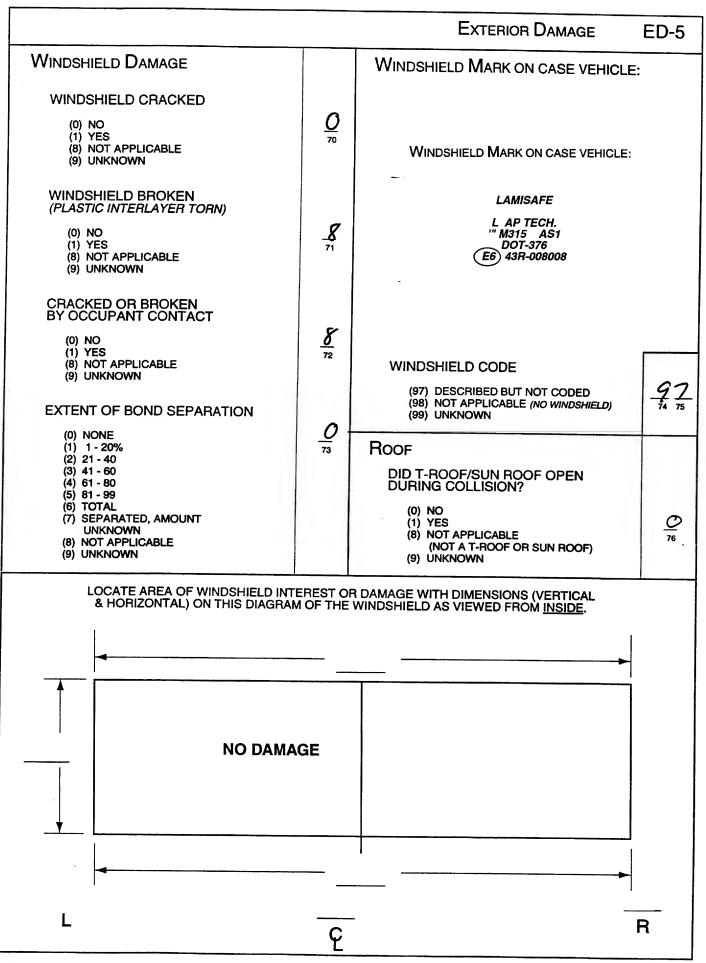

| Duplicate columns 1-8 Module S C Format 0 from the previous card. 9 10 11 | | STEERING WHEEL AND COLUMN | SC-1 |
|--|----------|--|----------------|
| STEERING WHEEL | | STEERING WHEEL POSITION AT TIME OF COLLISION | |
| STEERING WHEEL RIM DAMAGE (0) NONE (1) DEFORMED SLIGHTLY (2) SEVERELY BENT (3) BROKEN (9) UNKNOWN | <u></u> | IN WHAT O'CLOCK POSITION WAS THE NORMAL TOP OF THE WHEEL POINTED WHEN THE COLLISION OCCURRED? EXAMPLES O'CLOCK = 1 2. O'CLOCK = 0 2 | |
| NUMBER OF STEERING WHEEL SPOKES (9) UNKNOWN | 2 14 | (NORMAL STRAIGHT AHEAD) O'CLOCK = 91 | |
| STEERING WHL SPOKE DAMAGE (0) NONE (1) DEFORMED SLIGHTLY (2) SEVERELY BENT (3) BROKEN (9) UNKNOWN | <u>Ø</u> | STEERING WHEEL ENERGY ABSORBING DEVICE (1) EXAMPLES: BARRACUDA, 70 - 74 CHALLENGER, 70 - 74 CAPRI, 71 - 77 | |
| STEERING COLUMN OPTIONS | | (2) EXAMPLES: OMNI, 78 - HORIZON, 78 - | |
| TILT FEATURE (0) NOT EQUIPPED (1) YES, EQUIPPED, UNK POSITION (2) UP (3) MIDDLE (4) LOWER (9) UNKNOWN IF EQUIPPED | 3 16 | TYPE OF DEVICE (0) NONE (1) CONVOLUTED OR MESH CYLINDER (2) DEEP DISH STEERING WHEEL (7) OTHER: (8) NOT COLLECTED (9) UNKNOWN IF EQUIPPED | <u>8</u> 19 |
| SWING-AWAY FEATURE (0) NOT EQUIPPED (1) YES, EQUIPPED (9) UNKNOWN IF EQUIPPED | <u>O</u> | ORIGINAL DIMENSION (mm) A: DAMAGE DIMENSION (mm) B: DIFFERENCE (mm) | |
| TELESCOPING FEATURE (0) NOT EQUIPPED (1) YES, EQUIPPED (9) UNKNOWN IF EQUIPPED | <u>O</u> | A - B (888) NOT COLLECTED (991) NOT MEASURED/NO APPARENT COMPRESSION (992) COMPRESSED, AMOUNT UNKNOWN (993) DEVICE EXTENDED (997) UNABLE TO MEASURE (998) NOT APPLICABLE (NOT EQUIPPED) (999) UNKNOWN | 8 8 8 22 |

| | | STEERING WHEEL AND COLUMN | SC-2 |
|---|-----------|--|----------|
| STEERING COLUMN | | STEERING WHEEL (CONTINUED) | |
| ENERGY ABSORBING DEVICE | | , | |
| TYPE OF DEVICE * (IF 27 OR 28) | | STEERING WHEEL HUB DAMAGE | |
| (00) NOT EQUIPPED (88) NOT COLLECTED (99) UNKNOWN | 8 8 24 | (0) NONE (1) OCCUPANT CONTACT (2) AIRBAG | <u>0</u> |
| ORIGINAL LENGTH (mm) | | - (3) OTHER (9) UNKNOWN | |
| C: | | | |
| COMPRESSED LENGTH (mm) | | | |
| D: | | | |
| BRACKET DEFLECTION (IF CODE 36, 48, OR 49 ABOVE) | | - | |
| COMPRESSION (OR EXTRUSION) (mm) | | | |
| C - D (OR E) (TOLERANCE: ±10) | | | |
| (888) NOT COLLECTED (991) NOT MEASURED/NO APPARENT COMPRESSION (992) COMPRESSED, AMOUNT UNKNOWN (993) DEVICE EXTENDED (997) UNABLE TO BE MEASURED (998) NOT APPLICABLE (NOT EQUIPPED) (999) UNKNOWN | 8 8 8 27 | | |
| * (ADD A & B FOR TOTAL COMPRESSION) | | | |
| SHEAR CAPSULE SEPARATION (mm) | | | |
| S (USE AVG. OF LEFT & RIGHT CAPSULES.) | | | |
| RT: | | | |
| (888) NOT COLLECTED (991) NOT MEASURED/NO APPARENT SEPARATION (992) SEPARATED, AMOUNT UNKNOWN (997) UNABLE TO BE MEASURED (998) NOT APPLICABLE (NOT EQUIPPED) (999) UNKNOWN | 8 8 8 | · | |
| COLUMN VERTICAL ROTATION | | | |
| (0) NO APPARENT ROTATION (1) UPWARD APPARENT ROTATION (2) DOWNWARD APPARENT ROTATION (9) UNKNOWN | <u>Ø</u> | | |
| COLUMN LATERAL ROTATION | | | |
| (0) NO APPARENT ROTATION (1) LEFT APPARENT ROTATION (2) RIGHT APPARENT ROTATION (9) UNKNOWN | <u>35</u> | | |

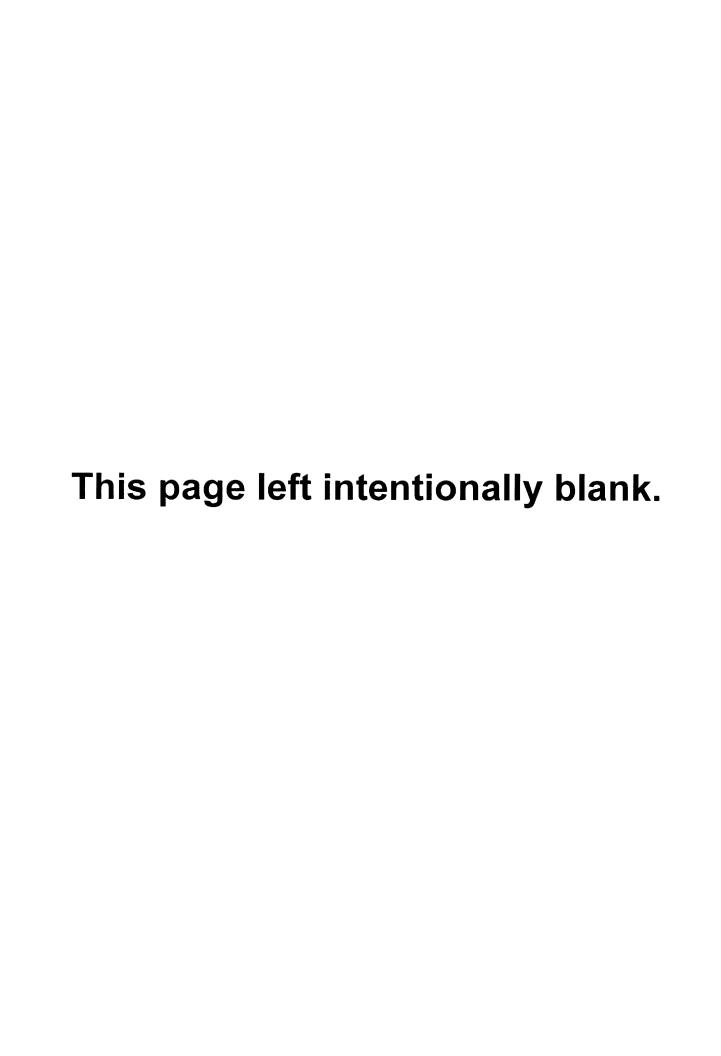


1 = Definitely 2 = Probably 3 = Possible

| | | | | | | INT | RUSION IT-1 |
|-------------|--------------------|---------------------------------------|---------------------------------------|---------------------------------------|---|-------------|-------------|
| | | (All Me | (All Measurements Are in Centimeters) | | | | |
| Location of | | Comparison | _ | Intruded | = | | Crush |
| Intrusion | Intruded Component | Value | | Value | - | Intrusion | Direction |
| none | | | | _ | = | | |
| | | | _ | | = | | |
| | | | _ | | = | | |
| | | | _ | | = | | |
| | | | _ | | = | | |
| | | | _ | | = | | |
| | | | | | = | | |
| | | | | | | | |
| | | | | · · · · · · · · · · · · · · · · · · · | | | |
| | | · · · · · · · · · · · · · · · · · · · | | | | | |
| | | | | | = | | |
| | | | | · · · · · · · · · · · · · · · · · · · | = | | |
| | | | _ | | = | | |
| | | | _ | | = | | |

OCCUPANT CONTACT WORKSHEET

| | ~········ | | | | |
|---------|---------------|----------|-----------|----------------------------------|------------|
| | | | | | Confidence |
| | Interior | Occupant | Body | | Level of |
| | Component | No. if | Region | | Contact |
| Contact | Contacted | Known | if Known | Supporting Physical Evidence | Point |
| Α | knee bolster | 1 | left knee | scuff mark (left side of column) | 1 |
| В | roof siderail | 1 | left hand | cuts in plastic | 1 |
| C | | | | | |
| D | | | | | |
| E | | | | | |
| F | | | | | |
| G | | | | | |
| Н | | | | | |
| l | | | | | |

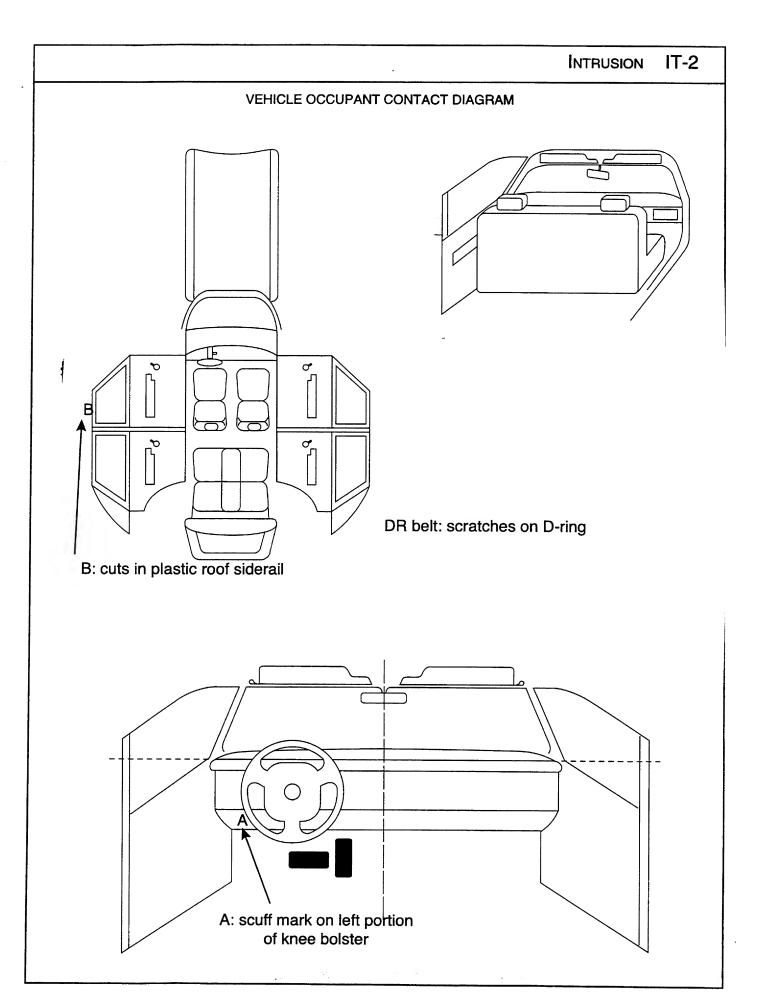

CODES FOR COLUMN B, OCCUPANT SPACE NUMBER

OCCUPANT SPACE NUMBER IS A TWO-DIGIT CODE. THE USE OF THE CODE IS DETERMINED BY THE VEHICLE SEAT CONFIGURATION AT THE TIME OF THE ACCIDENT.

FIRST DIGIT

THE FIRST DIGIT (LEFT DIGIT) DENOTES THE SEAT ROW, WITH CODE VALUES FROM 1 TO 5.

SECOND DIGIT

THE SECOND DIGIT (RIGHT DIGIT) DENOTES THE POSITION ON THE SEAT AND, IN SOME INSTANCES, THE WIDTH OF THE SEAT.


| (1) | LEFT | (3) RIGHT | ••••• | | INDIVIDUAL SEAT |
|-----|-----------------|--------------------|-------|--------------------|--------------------------------|
| (1) | LEFT | (2) CENTER | (3) | RIGHT | BENCH: FULL WIDTH 3 PASSENGER |
| (1) | LEFT | (2) LEFT CENTER | (6) | RIGHT (3) RIGHT | BENCH: FULL WIDTH 4 PASSENGER |
| (1) | LEFT | (2) CENTER | (5) | RIGHT &AISLE SPACE | BENCH: PARTIAL WIDTH, LEFT |
| | LEFT & SPACE | (2) CENTER | (5) | RIGHT &SPACE | BENCH: PARTIAL WIDTH, CENTERED |
| (4) | ENTIRE V | EHICLE WIDTH | | | CARGO AREA |

EXAMPLES

THE TWO FIGURES BELOW PROVIDE EXAMPLES OF THE OCCUPANT SPACE NUMBER.

PASSENGER CAR 5 PASSENGERS

VAN 12 PASSENGER CAPACITY

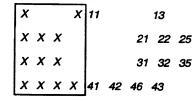

CODES FOR COLUMN F, MEASUREMENT AXIS

(X) X-AXIS (FORE & AFT)

(Y) Y-AXIS (LATERAL)

(Z) Z-AXIS (VERTICAL)

CODES FOR COLUMNS G, H, I & J, OCCUPANT & INJURY NUMBERS

| OCCUPANT NUMBER | INJURY NUMBER | CONTACT |
|--------------------|------------------|---|
| (00) | (00) | NO CONTACT |
| (##) | (00) | CONTACT, NO INJURY |
| (97) | (99) | CONTACT, OCCUPANT UNKNOWN, INJURY UNKNOWN |
| (99) | (00) OR (99) | UNKNOWN IF CONTACT |

CODES FOR COLUMN C, INTRUDING COMPONENT OR OBJECT

NOTE: <u>DO NOT</u> CODE OBJECTS OTHER THAN COMPONENTS OF CASE VEHICLE.

INDIVIDUAL COMPONENT

INTERNAL

- (01) INSTRUMENT PANEL
- (02) FIRE WALL
- (03) TOE PAN
- (04) FLOOR PAN
- (05) STEERING COLUMN
- (06) WINDSHIELD
- (07) WINDSHIELD HEADER
- (08) A-PILLAR
- (09) DOOR PANEL OR SIDE PANEL
- (10) WINDOW FRAME
- (11) B-PILLAR
- (12) C-PILLAR
- (13) D-PILLAR
- (14) ROOF SIDE RAILS
- (15) ROOF OR CONVERTIBLE TOP
- (16) BACKLIGHT HEADER
- (17) FRONT SEAT-BACK SURFACE/ SEAT-BACK BACK SURFACE
- (18) SECOND SEAT-BACK SURFACE SEAT-BACK BACK SURFACE
- (19) THIRD SEAT-BACK SURFACE SEAT-BACK BACK SURFACE
- (20) FOURTH SEAT-BACK SURFACE SEAT-BACK BACK SURFACE
- (21) FIFTH SEAT-BACK SURFACE SEAT-BACK BACK SURFACE
- (22) BACK PANEL/BACK DOOR SURFACE
- (23) SEAT CUSHION SURFACE/EDGE
- (24) CONSOLE
- (25) OTHER (DESCRIBE)
- (26) UNKNOWN INTERNAL SURFACES
- (28) TRANSMISSION TUNNEL (HUMP)
- (29) SIDE FOOTWELL PANEL (KICKPÁNEL)
- (30) SILL

EXTERNAL

- (43) HOOD
- (44) OBJECT EXTERNAL TO PASSENGER COMPARTMENT BUT PART OF CASE VEHICLE
- (45) OUTSIDE SURFACE OF CASE VEHICLE
- (46) OTHER (E.G. SPARE TIRE, JACK. DESCRIBE.)
- (49) UNKNOWN EXTERNAL OBJECT

GROUPED FOR MASSIVE INTRUSION INTO AN OCCUPANT SPACE

USE ONLY IF ALL THESE COMPONENTS INTRUDED INTO A SINGLE OCCUPANT SPACE.

- (50)WINDSHIELD HEADER A-PILLAR
 - ROOF SIDE RAIL
- (51)INSTRUMENT PANEL A-PILLAR DOOR PANEL
- (52)INSTRUMENT PANEL A-PILLAR
- WINDSHIELD HEADER
 (53)DOOR PANEL
- B-PILLAR ROOF RAIL
- (54)DOOR PANEL A-PILLAR ROOF RAIL
- (55)INSTRUMENT PANEL FLOOR PAN A-PILLAR DOOR FRAME
- (56)ROOF RAIL
 A-PILLAR
 B-PILLAR
 WINDOW FRAME
- (57)ROOF RAIL A-PILLAR B-PILLAR C-PILLAR DOOR PANEL
- (58) ROOF ROOF RAIL WINDOW FRAME DOOR PANEL
- (59)BACKLIGHT HEADER ROOF C-PILLAR THIRD SEAT-BACK

- (60)ROOF
 ROOF RAIL
 A-PILLAR
 B-PILLAR
 C-PILLAR
 WINDOW FRAME
 DOOR PANEL
- FLOOR PAN

 (61)INSTRUMENT PANEL
 TOE PAN
 WINDSHIELD HEADER
 A-PILLAR
 ROOF RAIL
 WINDOW FRAME
- (62)ROOF
 ROOF RAIL
 C-PILLAR
 WINDOW FRAME
 FLOOR PAN
 SECOND SEAT
 DOOR PANEL

DOOR PANEL

ROOF

- (63)ROOF RAIL
 ROOF
 B-PILLAR
 WINDOW FRAME
 FLOOR PAN
 DOOR PANEL
 SECOND SEAT
 FRONT SEAT
- (64)ROOF RAIL
 ROOF OR CONVERTIBLE TOP
 A-PILLAR
 B-PILLAR
 WINDOW FRAME
 WINDOW HEADER
- (65)WINDSHIELD WINDSHIELD HEADER ROOF SIDE RAIL
- (66)WINDSHIELD WINDSHIELD HEADER A-PILLAR

(98)NOT APPLICABLE

(99)UNKNOWN

| Duplicate columns 1-8 Module from the previous card. | 9 10 Format 0 | 1 12 | | | Inte | RUSION | IT-5 |
|---|--|-------------------------------------|-------------------------------------|-------------------------------|------------------|---|------------------|
| WAS THERE OCCUPANT COM (0) NO <u>DO NOT</u> ANSWER NEXT QUES (9) UNKNOWN <u>SKIP PAGE</u> . | CT QUESTION. <u>SKIP PAC</u> | 1 | <i>Q</i> v | VAS INTRUSI (0) NO (1) YES | COMPLETE PA | | 14 |
| Duplicate columns 1-8 Module from the previous card. NOTE: Each line in the table below | | 12 | olicate column: | s 1 - 12 for each | n completed li | ine. | |
| | TRUSIONS IN THIS C FOR B, F, G, H, I, J FOR C ON PAGE IT-4 | ON PAGE I | | | ONT TO BAC | | S. |
| A B C | D E ASSOC. MAXIMUM | F | G _ | , Н | 1 | J | κ |
| INTRUSION OCC. COMPONENT NUMBER SPACE NO. OR OBJECT | EVENT INTRUSION | MAXIMUM INTRUSION Y AXIS (cm) | MAXIMUM INTRUSION Z AXIS (cm) | OCCUPANT NUMBER | INJURY NUMBER | OCCUPANT NUMBER | INJURY NUMBER |
| 13-14 15-16 17-18 | 19 20-21 | 22-23 | 24-25 | 26-27 | 28-29 | 30-31 | 32-33 |
| 0 1 | | | | | | | |
| 0 2 | | | | | | | |
| 03 | | | | | | | |
| 0 4 | | | | | | | |
| 0 5 | | | | | | | |
| 06 | | | | | | | |
| 0 7 — — — — — — NOTE: USE ADDITIONAL PAGE IF MORE TH | AN 7 INTRUSIONS. | | | | | | |
| Duplicate columns 1-8 Module from the previous card. | I T Format 0 11 | | | | | I | |
| NOTE: IF NO SIDE DOOR INTRUSION, SKIP REMAINDER OF PAGE. SIDE DOOR INTRUSION RESULTED FROM | IF DAI DOOF | RINTRUSI | DOOR CO | MPONENT E COMPONE | ENT | D IN INCRE | EASED |
| INTRUSION | NUMBE | | MPONENT 1 | | NENT 2 | CODES FOR COMPONE | ENTS |
| NUMBER CAUSE CODES FOR CAUSE: | A | _ | _ | 25 | • | (0) NONE (1) A-PILLAR | |
| 13 15 (1) DIRECT | B | _ | | 29 | _ | (2) B-PILLAR (3) C-PILLAR (4) LATCH/STR | IKER |
| | C | _ | | 33 | _ (| (5) HINGES (7) OTHER: | - |
| 19 21 (9) UNKNOWN | D | _ | | 37 | _ | (8) NOT APPLK (9) UNKNOWN | CABLE |

Duplicate columns 1-8 from the previous card.

INTRUSION

IT-6

NOTE: Each line in the table below is a separate record (card).

Duplicate columns 1 - 12 for each completed line.

- ADDITIONAL PAGE -

INTRUSIONS CODE INTRUSIONS IN THIS ORDER: LEFT TO RIGHT ON ROW; FRONT TO BACK IN VEHICLES.

CODES FOR B, F, G, H, I, J ON PAGE IT-3

CODES FOR C ON PAGE IT-4

OCCUPANT CONTACT AND INJURY

| A INTRUSION NUMBER | B OCC. SPACE NO. | C INTRUDING COMPONENT OR OBJECT | | E MAXIMUM INTRUSION X AXIS (cm) | F MAXIMUM INTRUSION Y AXIS (cm) | G MAXIMUM INTRUSION Z AXIS (cm) | H OCCUPANT NUMBER | I INJURY NUMBER | J OCCUPANT NUMBER | K INJURY NUMBER |
|--------------------------|------------------------|--|----|--|--|--|-------------------------|-----------------------|-------------------------|-----------------------|
| 13-14 | 15-16 | 17-18 | 19 | 20-21 | 22-23 | 24-25 | 26-27 | 28-29 | 30-31 | 32-33 |
| 0 8 | | | _ | | | | | | | |
| 0 9 | | | | | | | | | | |
| 1 0 | | | | | | | | | | |
| 11 | | | _ | | | | | | | |
| 12 | | | | | | | | | | |
| 1 3 | | | | | | | | | | |
| 1 4 | | | | | | | | | | |
| <u>1</u> <u>5</u> | | | _ | | | | · | | | |
| 16 | | | | | | | | | | |
| 1 7 | | | | | | | | | | |
| 1 8 | | | | | | | | | | |
| 19 | | | | | | | | | —— | |
| 20 | | | | | | | | | | |
| 2 1 | | | _ | | | | | | | |
| 22 | | | _ | | | | | | | |
| 2 3 | | | | | | | | | | |
| 24 | | | _ | | | | | | | |
| 2 5 | | | _ | | | | | | | |

| Duplicate columns 1-8 from the previous card. | Module | e <u>I</u> <u>D</u> | Format <u>0</u> <u>1</u> | | ln ⁻ | TERIOR DAMAGE II | D-1 |
|---|--|--|---|-------|---|---|--------------------------------|
| CO | (1) |) NO) YES) NO, and | OCCUPANT CONTACT | (8) N | ES, and C IOT APPLI | | |
| SIDES FRONT DOOR FRONT HARDWARE FRONT ARMREST FRONT GLASS REAR DOOR AREA REAR HARDWARE REAR ARMREST REAR GLASS ROOF SIDE RAIL B-PILLAR C-PILLAR D-PILLAR HEADLINING ROOF STRUCTURE T-ROOF/SUN ROOF OTHER: * | (3) LEFT O 13 O 15 O 17 O 19 O 21 O 23 O 25 O 27 4 29 O 31 O 33 W 35 O 37 O 39 O 41 W 43 | NO, and RIGHT RIGHT O 14 O 15 O 25 O 2 | FRONT FOOT CONTROLS IGNITION KEYS REAR VIEW MIRROR SUNVISOR/FITTINGS (5) LEFT SIDE ONLY (6) RIGHT SIDE ONLY (7) BOTH SIDES WINDSHIELD TOP MOLDINGS LEFT A-PILLAR (UPPER OR LOWER) RIGHT A-PILLAR (UPPER OR LOWER) CENTER CONSOLE TRANSMISSION SELECTOR LEVER RIM, HORN, SPOKE | (9) | O 45 O 46 O 47 O 48 O 59 O 50 O 53 O 54 | INSTRUMENT PANEL UPPER PANEL MID PANEL LOWER PANEL ASHTRAY CONTROL KNOBS & LEVERS GLOVE COMPARTMENT AREA INSTRUMENTS PARKING BRAKE RELEASE PARKING BRAKE PEDAL A/C OR UPPER VENT OUTLETS HEATER OR A/C DUCTS RADIO OTHER: * REAR WINDOW WINDOW HEADER CONSOLES VERTICAL | 64 0 65 66 8 67 67 |
| | | | | | | ROOF | 0 70 9 1 |

^{*} MORE THAN ONE ITEM MAY BE NOTED.


| Duplicate columns 1-8 Module S T from the previous card. 9 10 | | 2 12 | SEATS | | ST-1 |
|---|-------------|-------------|---|----------|----------|
| FRONT SEAT | DRIVER | Passenia | FRONT SEAT-BACK | DRIVER | Passent |
| TYPE OF FRONT SEAT (00) NO SEAT (01) STANDARD BENCH (02) SPLIT BACK, 50-50 (03) SPLIT BACK, DRIVER WIDE (04) SPLIT BACK, PASS. WIDE (05) BUCKET (06) CAPTAIN'S CHAIR (07) INDIV. BENCH, 50-50 (08) INDIV. BENCH, DRIVER WIDE (09) INDIV. BENCH, PASS. WIDE (97) OTHER: | 05 | 05 15 16 | SEAT-BACK TYPE (1) FORWARD FOLDING (2) RIGID (3) RECLINING (7) OTHER: (8) NOT APPLICABLE (9) UNKNOWN SEAT-BACK LOCK TYPE | 30 | 31 |
| (99) UNKNOWN TYPE OF SEAT MOUNT (1) STANDARD (2) PEDESTAL (7) OTHER: (8) NOT APPLICABLE (9) UNKNOWN | 17 | 18 | (0) NONE (1) MANUAL (2) INERTIA (3) POWER (7) OTHER: (8) NOT APPLICABLE (9) UNKNOWN | 32 | 33 |
| SWIVEL MECHANISM EQUIPPED (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN | <u>O</u> | 0 20 | LOCKS HELD (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN | 34 | 35 |
| ORIGINAL EQUIPMENT SEATS (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN | 1 21 | 22 | RECLINER MECHANISM HELD (0) NO | 7 | 1 |
| CONTACT OF SEAT BY REAR OCCUPANT (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN | 8 23 | <u>\$</u> | (1) YES (8) NOT APPLICABLE (9) UNKNOWN | 36 | |
| FRONT SEAT DAMAGE (0) NONE (1) BACKREST ONLY DAMAGED (2) CUSHION ONLY DAMAGED (3) BACKREST & CUSHION DAMAGED (8) NOT APPLICABLE (9) UNKNOWN | <u>O</u> 25 | <u>O</u> 26 | HEAD RESTRAINT HEAD RESTRAINT TYPE (0) NONE (1) ADJUSTABLE (2) INTEGRAL (3) NOT INTEGRAL, BUT CANNOT BE REMOVED (7) OTHER: (8) NOT APPLICABLE | 38 | 89 |
| CENTER ARMREST DAMAGED (0) NO (1) YES (7) EQUIPPED, DAMAGE UNKNOWN (8) NOT APPLICABLE (NO CENTER ARMREST) (9) UNKNOWN IF EQUIPPED | 27 | <u> </u> | (9) UNKNOWN REMOVED PRE-CRASH (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN | Q 4 | <u>Q</u> |
| FRONT SEAT ROTATION | 0 | 0 | ADJUSTMENT AT CRASH (1) UP (2) DOWN (8) NOT APPLICABLE (9) UNKNOWN | 2 42 | 43 |
| (0) NONE APPARENT (1) FORWARD APPARENT (2) REARWARD APPARENT (3) LEFT APPARENT (4) RIGHT APPARENT (5) MULTIPLE ROTATIONS SPECIFY (8) NOT APPLICABLE (9) UNKNOWN | 28 | 29 | HEAD RESTRAINT DAMAGE (0) NONE (1) DAMAGED BUT NOT SEPARATED (2) SEPARATED (8) NOT APPLICABLE (9) UNKNOWN | <u>0</u> | <u>0</u> |

| | | | Se | EATS S | ST-2 |
|---|-------------|--|--|--------|----------|
| FRONT SEAT ADJUSTMENT | DRIVER | PASSEN'R | SECOND SEAT (CONT.) | | |
| SEAT ADJUSTMENT TYPE (0) NONE (RIGID) (1) MANUAL (2) POWER (7) OTHER: (8) NOT APPLICABLE (NO SEAT) (9) UNKNOWN ADJUSTMENT PROVIDED | 46 | PASSENR SECOND SEAT (CONT.) CENTER ARMREST DAMAGED (0) NO (1) YES (7) EQUIPPED, DAMAGE UNKNOWN (8) NOT APPLICABLE (9) UNKNOWN IF EQUIPPED 51 (0) NO (1) YES (1) YES (2) ONT APPLICABLE (9) UNKNOWN LEFT OR CENTER, EQUIPPED (3) SEAT FOLDED DOWN RIGHT, EQUIPPED (3) SEAT FOLDED DOWN THIRD SEAT RIGHT EQUIPPED BACKREST DAMAGED (3) SEAT FOLDED DOWN THIRD SEAT CUSHION DAMAGED TO THE EQUIPPED WITH REAR HEAD RESTRAINTS (0) NOT EQUIPPED (0) REMOVED) (1) EQUIPPED (0) REMOVED) (1) EQUIPPED (1) EQUIPPED (2) EQUIPPED (3) SONT APPLICABLE (4) (5) ONT APPLICABLE (6) (7) ONT EQUIPPED (7) ONT EQUIP | 8 | | |
| (1) 2-WAY (2) 4-WAY (3) 6-WAY (7) OTHER: (8) NOT APPLICABLE (9) UNKNOWN | 48 | 49 | (9) UNKNOWN IF EQUIPPED SECOND SEAT-BACK | LEFT | Rіgнт |
| SEAT ADJUSTER DAMAGE (0) NONE (1) CHUCKING (FREE PLAY) (2) DEFORMED (RELEASED/JAMMED) (3) SEPARATED (7) OTHER: (8) NOT APPLICABLE (9) UNKNOWN | <u>O</u> 50 | <u>O</u> 51 | (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN | / | 0 |
| SEAT ADJUSTER SEPARATION (0) NONE (1) SEPARATED AT FLOOR (2) SEPARATION OF ADJUSTER (3) SEPARATED AT SEAT (8) NOT APPLICABLE (9) UNKNOWN | <u>8</u> | | LEFT OR CENTER, HELD (3) SEAT FOLDED DOWN | 63 | _/ |
| PRE-CRASH POSITION (1) FORWARD (2) MIDDLE (3) REARWARD (8) NOT APPLICABLE (9) UNKNOWN | 2 | 2 55 | (3) SEAT FOLDED DOWN | 67 | <u>/</u> |
| SECOND SEAT TYPE OF SECOND SEAT | LEFT | RIGHT | EQUIPPED | 69 | <u> </u> |
| (0) NONE (1) NON-FOLDING (2) FOLDING (3) CAPTAIN'S CHAIR (4) JUMP SEAT | 2 56 | 2 57 | SEENR SECOND SEAT (CONT.) CENTER ARMREST DAMAGED (0) NO (1) YES (7) EQUIPPED, DAMAGE UNKNOWN (8) NOT APPLICABLE AND CENTER ARMREST) (9) UNKNOWN IF EQUIPPED SECOND SEAT-BACK LOCKS FOR THE FOLLOWING, USE: (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN LEFT OR CENTER, EQUIPPED LEFT OR CENTER, HELD (3) SEAT FOLDED DOWN RIGHT, EQUIPPED RIGHT, HELD (3) SEAT FOLDED DOWN THIRD SEAT GHT EQUIPPED BACKREST DAMAGED CUSHION DAMAGED VEHICLE EQUIPPED WITH REAR HEAD RESTRAINTS (0) NOT EQUIPPED (1) REMOVED) (1) EQUIPPED (2) EQUIPPED (3) NOT EQUIPPED (4) NOT EQUIPPED (5) NOT APPLICABLE (6) NOT APPLICABLE (7) NOT APPLICABLE (8) NOT APPLICABLE (9) UNKNOWN (1) YES (1) NOT EQUIPPED (1) REMOVED) (2) EQUIPPED & DAMAGED (3) NOT APPLICABLE (NO REAR SEAT) (9) UNKNOWN | 8 | |
| (5) INTEGRAL CHILD SEAT (6) LUGGAGE AREA ACCESS PANEL (9) UNKNOWN SECOND SEAT DAMAGE (0) NONE (1) BACKREST ONLY (DAMAGED OR LOOSENED) (2) CUSHION ONLY (DAMAGED OR LOOSENED) (3) BACKREST & CUSHION (DAMAGED OR LOOSENED) (4) INTEGRAL CHILD SEAT (PRIORITY CODE) (5) LUGGAGE AREA ACCESS PANEL (DAMAGED OR LOOSENED) (8) NOT APPLICABLE (9) UNKNOWN | 58 | ð_ | REAR HEAD RESTRAINTS (0) NOT EQUIPPED (OR REMOVED) (1) EQUIPPED (2) EQUIPPED & DAMAGED (8) NOT APPLICABLE (NO REAR SEAT) (9) UNKNOWN | 7. | <u>)</u> |


| Duplicate columns 1-8 Module A B Format of 10 from the previous card. |) <u>1</u> 1 12 | AIRBAG | AB-1 |
|--|--------------------|---|-------------|
| DRIVER SIDE LOCATION OF AIRBAG STEERING WHEEL EQUIPPED (0) NO (1) YES (4) PRIOR DEPLOYMENT NOT REINSTALLED (9) UNKNOWN IF AIRBAG EQUIPPED | 13 | PASSENGER SIDE LOCATION OF AIRBAG INSTRUMENT PANEL (GLOVE BOX) EQUIPPED - (0) NO (1) YES (4) PRIOR DEPLOYMENT NOT REINSTALLED (9) UNKNOWN IF AIRBAG EQUIPPED | 16 |
| (0) NO (1) YES (2) PARTIAL/IMPROPER DEPLOYMENT (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN | 14 | DEPLOYED (0) NO (1) YES (2) PARTIAL/IMPROPER DEPLOYMENT (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN | 17 |
| CONDITION OF AIRBAG STEERING WHEEL (0) NO DAMAGE (2) SPLIT OR TORN (3) CUT DURING CRASH (4) BURNED/MELTED (5) CUT POST CRASH (6) OTHER (7) DAMAGED, CONDITION UNKNOWN (8) NOT APPLICABLE (NOT EQUIPPED/NOT DEPLOYED) (9) UNKNOWN IF EQUIPPED OR CONDITION | 0 15 | CONDITION OF AIRBAG INSTRUMENT PANEL (GLOVE BOX) (0) NO DAMAGE (2) SPLIT OR TORN (3) CUT DURING CRASH (4) BURNED/MELTED (5) CUT POST CRASH (6) OTHER (7) DAMAGED, CONDITION UNKNOWN (8) NOT APPLICABLE (NOT EQUIPPEDNOT DEPLOYED) (9) UNKNOWN IF EQUIPPED OR CONDITION | <u>O</u> 18 |
| DRIVER SIDE AIRBAG STEERING WHEEL TETHER (0) NO (1) YES (6) OTHER (7) UNKNOWN IF TETHERED (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN IF AIRBAG EQUIPPED | 19 | PASSENGER SIDE AIRBAG INSTRUMENT PANEL (GLOVE BOX) TETHER (0) NO (1) YES (6) OTHER (7) UNKNOWN IF TETHERED (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN IF AIRBAG EQUIPPED | <u>Ö</u> |
| MARKED BY CONTACT (0) NO (1) YES (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN | <u>D</u> | MARKED BY CONTACT (0) NO (1) YES (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN | |

Driver Airbag

AIRBAG NUMBER ON DRIVER SIDE:

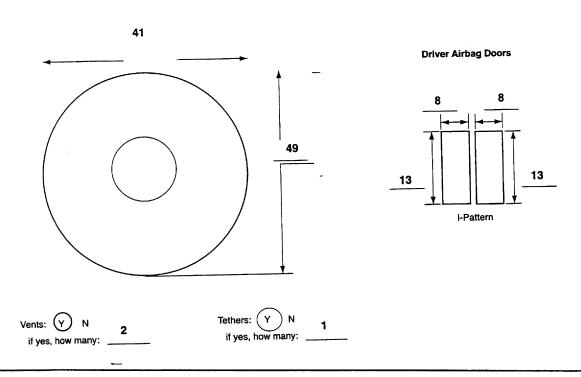

AIRBAG NUMBER ON PASSENGER SIDE:

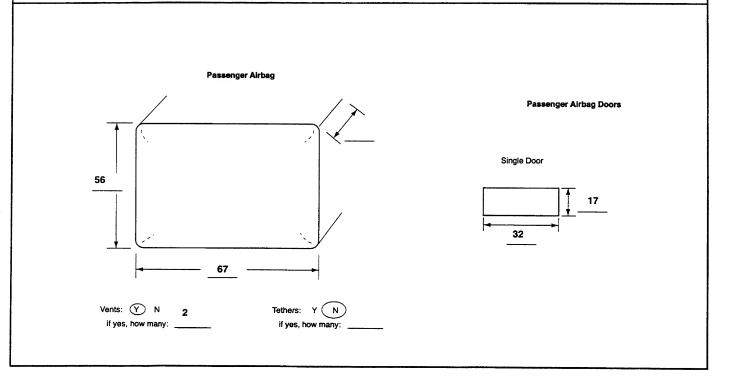

NOTE TO THE INVESTIGATOR:

THE FOLLOWING TWO SECTIONS,

OCCUPANT INFORMATION AND INJURY CLASSIFICATION,

ARE TO BE FILLED IN

FOR EACH CASE VEHICLE OCCUPANT,

WHETHER INJURED OR NOT.

IF THERE IS MORE THAN ONE OCCUPANT,

USE ADDITIONAL COPIES

OF PAGES OC-1, OC-2, OC-3,

AND IC-2 TO DESCRIBE THEM

AND ATTACH THE COPIES TO THIS REPORT.


| Duplicate columns 1-8 Module O C Format 0 from the previous card. 9 10 11 | 2 12 | Occupant Information (| OC-1 |
|---|-------------------------------------|---|---|
| OCCUPANT IDENTIFICATION OCCUPANT NUMBER ROLE OF OCCUPANT AT 1ST IMPACT (1) MOTOR VEHICLE DRIVER (2) MOTOR VEHICLE PASSENGER (NOT DRIVER) (9) UNKNOWN | <u>Q</u> <u>/</u> 13 14 <u>/</u> 15 | PHYSICAL DESCRIPTION AGE IN YEARS (00) LESS THAN 1 YEAR (98) 98 YEARS OR OLDER (99) UNKNOWN AGE IN MONTHS (00) LESS THAN 1 MONTH (25) 25 MONTHS OR OLDER (99) UNKNOWN MASS (kg) | 25 22 23 |
| OCCUPANT POSITION ROW LOCATION (1) FRONT (2) SECOND (3) THIRD (4) FOURTH (7) OTHER: (8) EXTERNAL TO PASSENGER COMPARTMENT (E.G. BED OF PICKUP) (9) UNKNOWN | 16 | (999) UNKNOWN (30) HEIGHT (cm) 516 (999) UNKNOWN SEX (1) MALE (2) FEMALE (9) UNKNOWN | 059 24 25 28 768 27 28 29 2 30 |
| LATERAL LOCATION (1) LEFT (2) LEFT CENTER (3) CENTER (4) RIGHT CENTER (5) RIGHT (6) ALL (LYING ON SEAT) (8) EXTERNAL TO PASSENGER COMPARTMENT (9) UNKNOWN POSTURE (10) SITTING ON SEAT (11) SITTING ON SEAT IN ABNORMAL POSITION (E.G. FEET ON DASH, SIDEWAYS) (12) SITTING ON CONSOLE (20) ON LAP OR IN ARMS (30) STANDING ON SEAT (40) STANDING ON FLOOR (47) STANDING, EXTERNAL TO PASSENGER COMPARTMENT (50) IN BASSINET (60) IN CHILD HARNESS (70) LYING ON SEAT (80) LYING/SITTING ON PASSENGER FLOOR (83) LYING/SITTING ON OTHER OBJECT IN PASSENGER COMPARTMENT: (85) ON CARGO FLOOR/FOLDED SEAT-BACK (87) LYING/SITTING, EXTERNAL TO PASSENGER COMPARTMENT (97) OTHER: (99) UNKNOWN | | MEDICAL CONDITIONS TREATMENT/MORTALITY (00) NONE (01) FIRST AID AT SCENE (02) TREATED AT HOSPITAL/CLINIC BUT NOT ADMITTED (03) HOSPITALIZED FOR OBSERVATION LESS THAN 24 HOURS (04) HOSPITALIZED OVER 24 HOURS OR FOR SIGNIFICANT TREATMENT (05) FATAL, DEAD AT SCENE (06) FATAL, DEAD WITHIN 24 HOURS (08) FATAL, DEAD WITHIN 24 HOURS (08) FATAL, DEAD 24 HOURS TO 31 DAYS LATER (09) FATAL, DEAD 31 DAYS TO 1 YEAR LATER (10) FATAL DEAD WITHIN UNKNOWN PERIOD (99) UNKNOWN INJURY SEVERITY SCORE (ISS) (99) UNKNOWN NON-IMPACT MED. CONDITIONS (0) NONE (1) YES, TIME & TYPE UNKNOWN (2) PRE-CRASH FATAL (CLINICAL DEATH AT WHEEL) (3) PRE-CRASH NON-FATAL (E.G. PRIOR INJURY, STROKE) (4) PREGNANT (5) POST-CRASH FATAL (DROWNING) (6) POST-CRASH NON-FATAL INJURY (7) OTHER: (8) COMBINATION OF ABOVE (CIRCLE EACH) (9) UNKNOWN | 0 3 34 0 35 |

| · | | Occupant Information | OC-2 |
|---|------|--|------------|
| MEDICAL CONDITIONS (CONT.) POLICE INJURY SEVERITY CODE FOR THIS OCCUPANT (0) O - NO INJURY (1) C - POSSIBLE INJURY (2) B - NON-INCAPACITATING (3) A - INCAPACITATING INJURY (4) K - FATAL (5) INJURED, SEVERITY UNKNOWN (6) DIED PRIOR TO IMPACT (7) NON-FATAL INJURY, SEVERITY UNKNOWN (9) UNKNOWN | 1 36 | CHILD SEAT TYPE (00) NONE USED (01) YES, USED (02) INTEGRAL, Chrysler Mini-van (88) NOT APPLICABLE (ADULT OR OLDER CHILD) (99) UNKNOWN CHILD SEAT MAKE/MODEL | 8 8 |
| RESTRAINT SYSTEM (0) NONE (1) LAP BELT (2) SHOULDER HARNESS ONLY (3) BOTH LAP BELT & SHOULDER HARNESS (9) UNKNOWN ACTIVE RESTRAINT SYSTEM USAGE (0) NONE (AVAILABLE BUT NOT USED) (1) LAP BELT ONLY (2) SHOULDER HARNESS ONLY (3) BOTH LAP BELT & SHOULDER HARNESS (7) IMPROPER USAGE (8) NOT APPLICABLE (NONE AVAILABLE) (9) UNKNOWN PASSIVE RESTRAINT SYSTEM (0) NONE (1) AIRBAG INSTALLED (2) PASSIVE UPPER TORSO WITH KNEE BOLSTERS (3) PASSIVE UPPER TORSO WITHOUT KNEE BOLSTERS (4) PASSIVE LAP & UPPER TORSO (5) AIRBAG INSTALLED & PASSIVE LAP & UPPER TORSO (5) AIRBAG INSTALLED & PASSIVE RESTRAINT (7) OTHER: (9) UNKNOWN | 3 35 | EJECTION (0) NONE (1) PARTIAL (2) COMPLETE (7) EJECTED, DEGREE UNKNOWN (9) UNKNOWN IF EJECTED AREA OF EJECTION (01) WINDOW, LEFT SIDE (02) WINDOW, RIGHT SIDE (03) WINDOW, REAR (04) DOOR, LEFT SIDE (05) DOOR, RIGHT SIDE (06) DOOR, RIGHT SIDE (07) WINDSHIELD (08) ROOF OR OPEN CONVERTIBLE OR FROM EXTERNAL AREA (96) EJECTED AREA UNKNOWN (97) OTHER AREA: (98) NOT APPLICABLE (NOT EJECTED) (99) UNKNOWN IF EJECTED | Q 43 45 45 |
| PASSIVE RESTRAINT SYSTEM USAGE (0) SYSTEM DEFEATED (1) AIRBAG NOT DEPLOYED (2) AIRBAG DEPLOYED (3) AIRBAG NOT REINSTALLED (4) PASSIVE UPPER TORSO USED (5) PASSIVE LAP & UPPER TORSO USED (6) SYSTEM USED IN MANUAL MODE (7) IMPROPER USAGE (8) NOT APPLICABLE (NOT ORIGINALLY EQUIPPED) (9) UNKNOWN | 2 40 | HEAD RESTRAINT HEAD RESTRAINT AVAILABLE FOR THIS POSITION (0) NOT EQUIPPED OR REMOVED (1) EQUIPPED (9) UNKNOWN | |

| | | OCCUPANT INFORMATION | OC-3 |
|--|------|---|------|
| OCCUPANT EYEWEAR (0) NONE (1) GLASSES (2) CONTACTS (3) BOTH GLASSES AND CONTACTS (4) OTHER (8) NOT APPLICABLE (9) UNKNOWN | 2 47 | SOURCE OF INFORMATION (0) INTERVIEW (1) HOSPITAL (2) AUTOPSY (3) POLICE (4) OTHER (5) LAY CORONER/EXTERNAL EXAM (7) COMBINATION OF ABOVE (CIRCLE) (8) NOT APPLICABLE (9) UNKNOWN | 7 48 |

OCCUPANT INFORMATION OC-4

INDICATE LOCATION OF INJURIES.

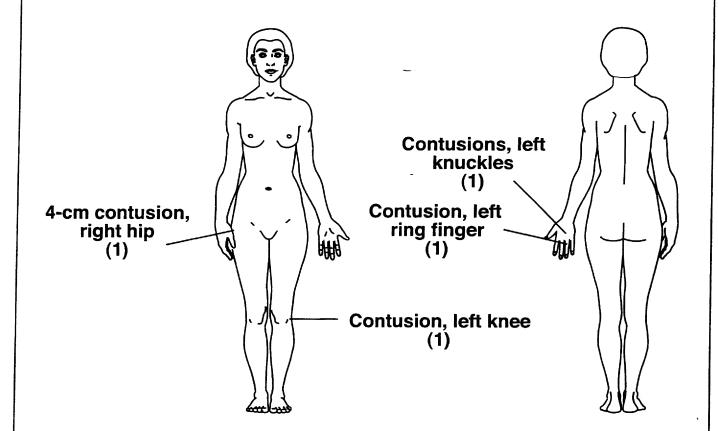

Duplicate columns 1-8 from the previous card.

Module <u>I</u> <u>C</u> Format <u>0</u> <u>1</u> 12

Injury Classification IC-1

NOTE: Each line in the table below is a separate record (card).

Duplicate columns 1 - 12 for each completed line.

OCCUPANT INJURY CLASSIFICATION

| | | | | | | PRIM | ARY (| DIC | | A | SSOC | IATE | OIC | | COMME | NT |
|--|---------------|--|-------|--|---------------|----------|----------|----------------|-------------|---------------|----------|----------|----------------|-------------|-------|----|
| OCCUPANT NUMBER | INJURY NUMBER | PLACE CONTACTS IN ORDER OF PROBABILITY (HORIZONTALLY). START WITH MOST PROBABLE IN 1ST CONTACT AREA COLUMN. AREA(S) OF POSSIBLE CONTACT 1ST 2ND | | IZONTALLY). PROBABLE REA COLUMN. | BODY REGION 1 | ASPECT O | LESION 3 | SYSTEM/ORGAN 4 | SEVERITY LD | BODY REGION 1 | ASPECT O | LESION 3 | SYSTEM/ORGAN 4 | SEVERITY 45 | | |
| 13-14 | 15-16 | 17-18 | 19-20 | COMMENTS | 21 | 22 | 23 | 24 | 25 | 26 | 27 | 28 | 29 | 30 | | |
| <u>o</u> L | OL | 26 | 27 | FIRS | W | <u>_</u> | c | I | | _ | _ | _ | _ | - | | |
| | 02 | 26 | 87 | fling | W | <u>L</u> | <u>c</u> | I | <u></u> | _ | _ | _ | _ | _ | | |
| | 03 | <u>3'3</u> | 27 | | P | <u>R</u> | <u>c</u> | I | <u>(</u> | _ | _ | | _ | _ | | |
| | 24 | 78 | | | K | <u>_</u> | <u>c</u> | I | <u>t</u> | _ | | _ | | - | | |
| | | | | | - | | _ | | _ | _ | _ | | | - | | |
| | | | | | - | | | _ | _ | _ | _ | | | - | | |
| | | | | | _ | | | | _ | _ | _ | _ | | - | | |
| ė | | | | | _ | | _ | | | _ | | — | | _ | | |
| Duplicate "Occupant Number" for each line. | | | | | - | _ | _ | _ | - | _ | _ | | | _ | | |
| | | | | | _ | _ | | _ | - | | _ | | _ | _ | | |
| | | | | | _ | | | | - | 8— | | | | - | | |
| | | | | | - | _ | | _ | - | _ | | | | _ | | |
| | | | | | _ | | _ | _ | - | _ | | _ | | -1 | | |
| | | | | | - | _ | _ | _ | - | _ | | _ | | - | | |
| | | | | | _ | | _ | | - | _ | _ | _ | | - | | |
| | | | | | _ | _ | | | - | _ | _ | _ | | - | | |
| | | | | | _ | _ | | | - | | _ | | _ | - | | |
| | | | | | | | | _ | _ | | _ | | _ | _ | | |

CODES FOR AREAS OF POSSIBLE OCCUPANT CONTACT

| _ | | | |
|---------------------------|---|-------------------|---|
| | OF PASSENGER COMPARTMENT | SIDES | |
| | SUNVISOR, FITTING(S) &/OR TOP MOLDING | (20) | SURFACE OF SIDE INTERIOR |
| (12) | WINDSHIELD | (19) | HARDWARE ON SIDE OR DOOR |
| (OE) | INISTRUMENT DAMEL (SPECIEIC AREA LINICAGUAD | (13) | ARMREST ON SIDE OR DOOR |
| (05) (54) | · | (24) | COAT HOOK |
| (5 4) (55) | MIDDLE INSTRUMENT PANEL (Y) | - (00) | WINDOW CLASS (CIDE) |
| (56) | LOWER INSTRUMENT PANEL (Z) | (22) | WINDOW GLASS (SIDE) WINDOW FRAMES (SIDE) |
| (81) | ASH TRAY (INSTRUMENT PANEL) | (21) | WINDOW FRAMES (SIDE) |
| (02) | GLOVE COMPARTMENT AREA | (26) | ROOF SIDE RAIL |
| (47) | AIRBAG (ACRS) COMPARTMENT DOOR/COVER | , , | A-PILLAR |
| ` ' | , | , , , | B-PILLAR |
| (57) | BENEATH INSTRUMENT PANEL | , , | C-PILLAR |
| (53) | PARCEL TRAY | (17) | D-PILLAR |
| (48) | KNEE RESTRAINT | _ | |
| (86) | VERTICAL CONSOLE | FLOOR | |
| | | | FLOOR |
| (28) | FOOT CONTROLS (INCL. PARKING BRAKE PEDAL) | (27) | |
| (00) | CTTERING ACCEMBLY (CEFOIEIC ACCALINATIONS) | (44) | |
| (09) | STEERING ASSEMBLY (SPECIFIC AREA UNKNOWN) | (85) | |
| (65) (66) | STEERING WHEEL STEERING WHEEL COLUMN | | FOOT CONTROLS (INCL. PARKING BRAKE PEDAL) |
| (59) | TRANSMISSION LEVER ON COLUMN | (91) | KICKPANEL |
| (50) | THATOMICCION EETEN ON COLUMN | Roof | |
| (03) | HARDWARE ITEM (SPECIFIC AREA UNKNOWN) | (25) | ROOF OR CONVERTIBLE TOP |
| (82) | INSTRUMENT(S) | (10) | |
| (83) | CONTROL KNOB(S) & LEVER(S) (FRONT) | (26) | |
| (84) | PARKING BRAKE HANDLE IN FRONT | | COAT HOOK |
| (67) | IGNITION KEY | (18) | |
| (06) | MIRROR | (39) | |
| (04) | HEATER OR AIR CONDITIONING DUCTS | (68) | ROOF MOUNTED CONTROLS/CONSOLE |
| (01) | AIR CONDITIONING OR VENTILATION OUTLET(S) | (69) | ROLL BAR |
| (08) | RADIO (BUILT IN) | _ | |
| (58) | ADD-ON TAPE DECK, RADIO, A/C | | PR SURFACE OF CASE VEHICLE |
| (68) | ROOF MOUNTED CONTROLS/CONSOLES | (37) | OUTSIDE SURFACE OF CASE VEHICLE |
| D | | | (SPECIFIC AREA UNKNOWN) |
| REAR | CUREAGE OF REAR INTERIOR | (35) | HOOD OF CASE VEHICLE |
| | SURFACE OF REAR INTERIOR | (60) | EXTERIOR OF CASE VEHICLE (E.G. |
| | REAR WINDOW REAR WINDOW HEADER | (00) | OUTSIDE MIRRORS, ANTENNA, TRIM) |
| | REAR SEAT CUSHION & BACK | (62) (63) | EXTERIOR SIDE ROOF RAIL OF CASE VEHICLE |
| (30) | HEATIGEAT GOGTHON & BACK | (64) | TRUNK LID OF CASE VEHICLE TIRES OF CASE VEHICLE |
| INTERIOR-GENERAL | | | |
| | TRANSMISSION SELECTION LEVER (LOCATION UNK.) | BEYOND | CASE VEHICLE BOUNDARY |
| (59) | TRANSMISSION LEVER ON STEERING COLUMN | (36) | AREA EXTERIOR TO CAR (SPECIFIC AREA UNK.) |
| (44) | TRANSMISSION LEVER ON FLOOR OR CONSOLE | (70) | HOOD OF OTHER VEHICLE |
| (07) | PARKING BRAKE HANDLE (LOCATION UNKNOWN) | (71) | OTHER VEHICLE EXTERIOR HARDWARE (E.G. |
| (84) | PARKING BRAKE HANDLE IN FRONT | | OUTSIDE MIRRORS, ANTENNA, TRIM) |
| (85) | PARKING BRAKE HANDLE ON FLOOR OR CONSOLE | (73) | EXTERIOR SIDE ROOF RAIL OF OTHER VEHICLE |
| (28) | FOOT CONTROLS (INCL. PARKING BRAKE PEDAL) | (74) | HEADLIGHT OR FRONT GRILL OF OTHER VEH. |
| | | (75) | TRUNK OF OTHER VEHICLE |
| (29) | FRONT SEAT-BACK(S) | (76) | OUTSIDE SURFACE OF OTHER VEHICLE |
| | FRONT SEAT CUSHION | (77) | TIRES OF OTHER VEHICLE |
| . , | REAR SEAT CUSHION & BACK | (78) | GROUND |
| (49) (89) | ARMREST ON SEAT UNDER SEAT BOTTOM | (79) | WATER |
| (69) | UNDER SEAT BOTTOM | (80) | EXTERIOR OBJECT (NOT VEHICLE, GROUND, |
| (33) | RESTRAINT SYSTEM HARDWARE | | OR WATER. PLEASE DESCRIBE.) |
| (34) | RESTRAINT SYSTEM WEBBING | PENETRA | ATING OBJECTS |
| (87) | AIR CUSHION SKIN (AIRBAG) | | OTHER VEHICLE |
| (47) | AIRBAG (ACRS) COMPARTMENT DOOR/COVER | (72) | OBJECTS (DESCRIBE) |
| (46) | AIRBAG GAS | \· - / | |
| (48) | KNEE RESTRAINT | MISCELL | ANEOUS |
| (30) | HEAD RESTRAINT | | NO CONTACT (INVALID FIELD FORM CODE) |
| (42) | CHILD SEAT RESTRAINTS | | OTHER (E.G. FIRE. DESCRIBE) |
| (43) | CHILD SEAT | | SPARE TIRE |
| (0.1) | INTERIOR LOOSE OBJECT | (96) | INDUCED |
| (31) | | , , | |
| (32) | OTHER OCCUPANT(S) | (97) | • |
| (32) (52) | OTHER OCCUPANT(S) INTERNAL FLYING GLASS (FROM ANY SOURCE) | , , | IMPACT FORCE, "WHIPLASH", |
| (32) | OTHER OCCUPANT(S) | (97) | • |

INJURY CLASSIFICATION IC-3 THE FIGURE BELOW IS AN EXPLANATION OF THE <u>BODY REGION</u> CODES LISTED ON PAGE IC - 4. (H) HEAD ___ (F) FACE --- (N) NECK --(S) SHOULDER _ (BS) THORACIC SPINE (C) CHEST -(A) UPPER ARM . (E) ELBOW -(R) FOREARM (W) WRIST (W) HAND (BI) LUMBAR SPINE (M) ABDOMEN -(P) PELVIS THIGH -- (K) KNEE-(L) LOWER LEG -(Q) ANKLE (Q) FOOT-

CODES FOR OCCUPANT INJURY CLASSIFICATION (OIC)

1 BODY REGION

- (H) HEAD/SKULL
- (F) FACE
- (N) NECK
- (S) SHOULDER
- (X) UPPER EXTREMITIES
- (A) ARM (UPPER)
- (E) ELBOW
- (R) FOREARM
- (W) WRIST/HAND
- (C) CHEST
- (M) ABDOMEN
- (B) BACK
- (P) PELVIC/HIP
- (Y) LOWER EXTREMITIES
- (T) THIGH
- (K) KNEE
- (L) LEG (LOWER)
- (Q) ANKLE/FOOT
- (O) WHOLE BODY
- (U) UNKNOWN

3 LESION

- (L) LACERATION
- (C) CONTUSION
- (A) ABRASION
- (F) FRACTURE
- (P) PERFORATION, PUNCTURE
- (K) CONCUSSION
- (V) AVULSION
- (R) RUPTURE
- (S) SPRAIN
- (D) DISLOCATION
- (N) CRUSH
- (M) AMPUTATION
- (B) BURN
- (G) DETACHMENT, SEPARATION
- (Z) FRACTURE AND DISLOCATION
- (T) STRAIN
- (E) TOTAL SEVERANCE, TRANSECTION
- (O) OTHER
- (U) UNKNOWN

4 SYSTEM/ORGAN

- (S) SKELETAL
- (V) VERTEBRAE
- (J) JOINTS
- (D) DIGESTIVE
- (L) LIVER
- (N) NERVOUS SYSTEM
- (B) BRAIN
- (C) SPINAL CORD
- (E) EARS
- (O) EYES
- (A) ARTERIES
- (H) HEART
- (Q) SPLEEN
- (G) UROGENITAL
- (K) KIDNEYS
- (R) RESPIRATORY
- (P) PULMONARY/LUNGS
- (M) MUSCLES
- (T) THYROID, OTHER ENDOCRINE GLAND
- (I) INTEGUMENTARY (SKIN)
- (W) ALL SYSTEMS IN REGION
- (U) UNKNOWN

2 ASPECT

- (R) RIGHT
- (L) LEFT
- (B) BILATERAL
- (C) CENTRAL
- (A) ANTERIOR/FRONT
- (P) POSTERIOR/BACK
- (S) SUPERIOR/UPPER
- (I) INFERIOR/LOWER
- (W) WHOLE REGION
- (U) UNKNOWN

SEVERITY 5 SYSTEM/ORGAN 4 LESION 9 ASPECT 0 BODY REGION 1

5 SEVERITY (OR "AIS", ABBREVIATED INJURY SCALE)

- (0) NONE
- (1) MINOR
- (2) MODERATE
- (3) SERIOUS
- (4) SEVERE
- (5) CRITICAL
- (6) MAXIMUM
- (9) UNKNOWN



N 21300 #1







et Availab



et Avoilet





st Availal











121300#12



PN 21300 #13 Best Available



PN 21300 #14 Best Available





























































CASE NO 21240 CASE VENICLE 1999 Securi OCCUPANT (Sever) Physics-role from SUA/Life (set emily) h disq. (MASS SE hg (24 le) SCSTANATS Septembels were winted deployed ACLER TY (MASS 1 (SS 1)



